cole

Access Compliance Report Public Rights-of-Way (Curb Ramps)



| | | | | | | | ~- | | | | |
|--|----------------------------------|---|-----------|---------|--|-----------------------|-------|-----------------------------|-----------------------------|-------|--|
| Intersection ID: 27962 | Main Street: PINE_VALLEY_CLUB_DR | | | Cross | Cross Street: ROYAL_ABERDEEN_CT | | | | Location: | NE | |
| ADA ID: 094CCB35125D | D Ramp Type: Perp | | | Initial | Initial Pass/Fail: Fail Overall Compliance: No | | | | o Severity Score: | 13.75 | |
| Codes/Mitigation Info/Possible Solution | | | | | Field Measurements/Component Compliance | | | | | | |
| | A MARTIN | Possible Solutions: | | | Compliance Description | | | Data Compliance Description | | | |
| A THE AND I THE | 174 82 | Remove & Replace Er | ntire Ram | 0. | N/A | Ramp Length (in) | 49.0 | No | Ramp Slope (%) | 10.6 | |
| I a man in the | C.A. A. | | - | | Yes | Ramp Width (in) | 48.0 | No | Ramp XSlope (%) | 2.2 | |
| | and the second | | | | N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A | |
| | | | | | N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A | |
| | 1 - C. | | | | N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A | |
| 53 | The set | | | | N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A | |
| A A A A A A A A A A A A A A A A A A A | | Surveyor Notes: | | | N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A | |
| A B B B B B B B B B B B B B B B B B B B | | N/A | | | N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A | |
| A A A A A A A A A A A A A A A A A A A | Ser 2 | | | | N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A | |
| A A A A A A A A A A A A A A A A A A A | Star C | | | | N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A | |
| A A A A A A A A A A A A A A A A A A A | | | | | N/A | Shared Landing? | N/A | | | | |
| The second secon | | PROW/ADA: | | | N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A | |
| V/// A VA | A. | Not Found, R304.2.2, | R304.5.3 | | N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A | |
| | | , | | | N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | N/A | |
| / ANY TRANK | 1 Bally | | | | | X Walk 1 Direction | To NW | | X Walk 2 Direction | N/A | |
| | | | | | N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A | |
| Street 1 Name PINE VALLE | EY CLUB DR | | | | | X Walk 1 Slope (%) | 3.5 | | X Walk 2 Slope (%) | N/A | |
| Stop Condition-Street 2 | None | | | | | X Walk 1 X Slope (%) | 1.5 | | X Walk 2 X Slope (%) | N/A | |
| Street 2 Name | N/A | | | | N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A | |
| Stop Condition-Street 1 | N/A | | | | | Road Slope (%) | 1.5 | N/A | Clear Space? | N/A | |
| | | | | | | Road X Slope (%) | 3.5 | N/A | Clear Space to XWalk (in) | N/A | |
| | | | | | N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A | |
| | | Total Cost: | \$ | 1850.00 | | Obstruction Type | | | Storm Grate/Utility Type | | |
| | | | | | | | N/A | | | N/A | |

Yes Surface Condition? (G/P)

Good

