

Intersection ID: 23581	Main Street: BRANDON_FOREST_DR	Cross Street: DRYDEN_LN	Location:	E
ADA ID: 1610DCCD5A11	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			N/A	Ramp Length (in)	32.0	No	Ramp Slope (%)	11.3
				Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.9
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2, R304.5.3</p>				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
				N/A	Shared Landing?	N/A			
				N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
					X Walk 1 Direction	To N		X Walk 2 Direction	To W
				N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	1.5
					X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	2.2
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	2.0	N/A	Clear Space?	N/A	
				Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
						N/A			N/A
							Yes	Surface Condition? (G/P)	Good
Street 1 Name			NEW HAMLIN WY						
Stop Condition-Street 2			StopSign						
Street 2 Name			BRANDON FOREST DR						
Stop Condition-Street 1			None						
Total Cost:			\$ 3200.00						

