


Intersection ID: 42983	Main Street: CHRUDAN_DR	Cross Street: LADORA_DR	Location:	E
ADA ID: 24CB2A6110C1	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 46.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

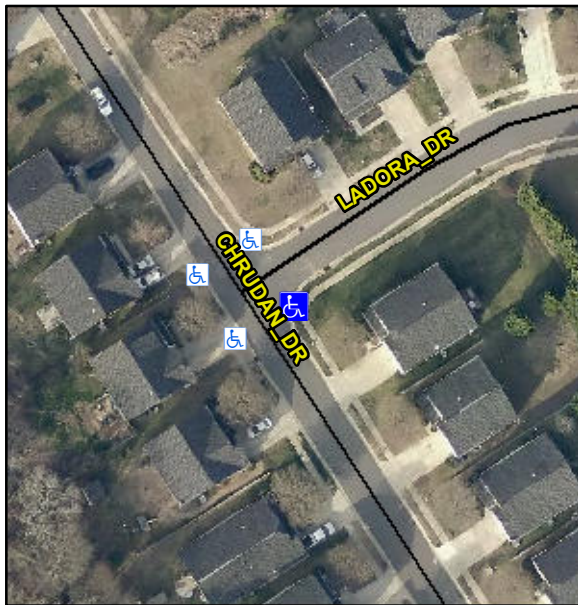

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.5.1, R304.2.2,
R304.5.3**

Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length (in)	46.5	No	Ramp Slope (%)	11.1	
	No	Ramp Width (in)	37.0	No	Ramp XSlope (%)	14.0	
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
Surveyor Notes: N/A	N/A	Shared Landing?	N/A				
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
		X Walk 1 Direction	To NW		X Walk 2 Direction	To SW	
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
		X Walk 1 Slope (%)	5.4		X Walk 2 Slope (%)	3.0	
		X Walk 1 X Slope (%)	8.8		X Walk 2 X Slope (%)	9.1	
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
		Road Slope (%)	9.7	N/A	Clear Space?	N/A	
PROW/ADA: Not Found, R304.5.1, R304.2.2, R304.5.3		Road X Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A	
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
		Obstruction Type			Storm Grate/Utility Type		
			N/A			N/A	
				Yes	Surface Condition? (G/P)	Good	
	Total Cost:	\$	3200.00				

Total Cost: \$ 3200.00

