


Intersection ID: 9046	Main Street: BRADFORD_DR	Cross Street: HOOVER_ST	Location:	N
ADA ID: 2B338219C3A7	Ramp Type: BlendTrans2	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
<p>1. <b>Code 100</b>: No visible signs of mold or mildew.</p> <p>2. <b>Code 101</b>: Minor mold/mildew on non-porous surfaces. Mitigation: Clean with appropriate disinfectant.</p> <p>3. <b>Code 102</b>: Moderate mold/mildew on porous surfaces. Mitigation: Remove and replace affected materials.</p> <p>4. <b>Code 103</b>: Severe mold/mildew throughout the space. Mitigation: Professional remediation required.</p>	<p>1. <b>Field Measurement 100</b>: All surfaces are clean and free of mold/mildew.</p> <p>2. <b>Field Measurement 101</b>: Mold/mildew is present on non-porous surfaces. Compliance: Surfaces must be cleaned and disinfected.</p> <p>3. <b>Field Measurement 102</b>: Mold/mildew is present on porous surfaces. Compliance: Affected materials must be removed and replaced.</p> <p>4. <b>Field Measurement 103</b>: Mold/mildew is present throughout the space. Compliance: Professional remediation is required.</p>

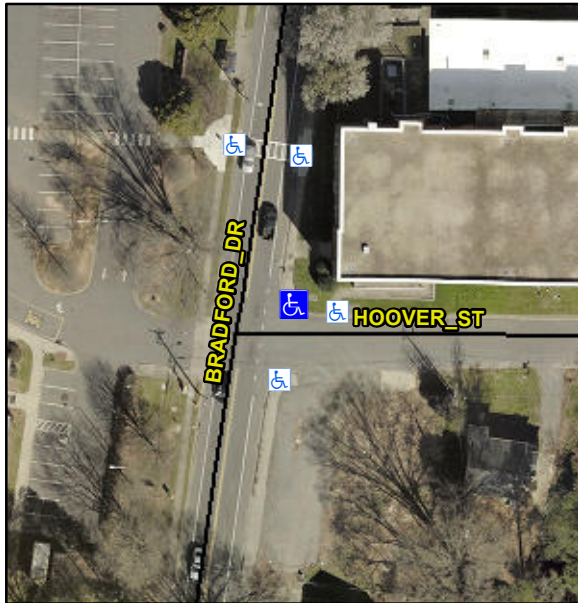

### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**NO RT SW**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	BlendTrans Slope (%)	3.1
No	Ramp Width (in)	36.0	No	BlendTrans XSlope (%)	5.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	6.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.5		Clear Space?	N/A
	Road X Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	16.2

Total Cost: \$ 3200.00

