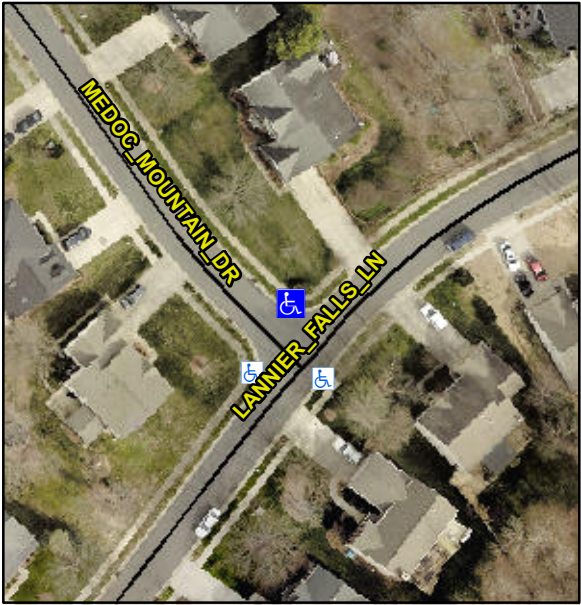


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | | |
|------------------------|-------------------------------|---------------------------------|------------------------|--------------------|
| Intersection ID: 29723 | Main Street: LANNIER FALLS LN | Cross Street: MEDOC MOUNTAIN DR | Location: | N |
| ADA ID: 4705E80E9F7C | Ramp Type: PerpDiag | Initial Pass/Fail: Fail | Overall Compliance: No | Severity Score: 10 |

| Codes/Mitigation Info/Possible Solution | | Field Measurements/Component Compliance | | | |
|---|--|--|-------------------|--------------------------|-------------|
|  <p>Street 1 Name MEDOC MOUNTAIN DR</p> <p>Stop Condition-Street 2 StopSign</p> <p>Street 2 Name LANNIER FALLS LN</p> <p>Stop Condition-Street 1 None</p> | <p>Possible Solutions:</p> <p>Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.</p> <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.1, R304.5.3</p> | <p>Total Cost:</p> <p>\$ 3200.00</p> | | | |
| | | | Compliance | Description | Data |
| | | | N/A | Ramp Length (in) | 51.5 |
| | | | No | Ramp Width (in) | 44.0 |
| | | | N/A | Flare Type LT | N/A |
| | | | N/A | Flare Slope LT (%) | N/A |
| | | | N/A | Flare Traversable LT? | N/A |
| | | | N/A | Landing Length (in) | N/A |
| | | | N/A | Landing Width (in) | N/A |
| | | | N/A | Landing Slope (%) | N/A |
| | | | N/A | Landing X Slope (%) | N/A |
| | | | N/A | Landing Curb? (Y/N) | N/A |
| | | | N/A | Shared Landing? | N/A |
| | | | N/A | Gutter Ponding? | N/A |
| | | | N/A | Gutter Lip Ht (in) | N/A |
| | | | N/A | Painted X Walk1? | No |
| | | | | X Walk 1 Direction | To SW |
| | | | N/A | X Walk 1 Width (in) | N/A |
| | | | | X Walk 1 Slope (%) | 0.5 |
| | | | | X Walk 1 X Slope (%) | 1.7 |
| | | | N/A | Ramp inside XWalk1? | N/A |
| | | | | Road Slope (%) | 1.0 |
| | | | | Road X Slope (%) | 0.4 |
| | | | N/A | Any Obstructions? | N/A |
| | | | | Obstruction Type | |
| | | | N/A | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

