

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

5.3

9.0

N/A

No

N/A

To NW

Intersection ID: 12968 Main Street: LINCOLN_ST Cross Street: S_MINT_ST Location: S

ADA ID: 591BDEB77442 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

Yes

No

N/A

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

Flare Traversable RT?

Data

26.0

48.0

N/A

No

N/A N/A

To NE



Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

LINCOLN ST StopSign S MINT ST None Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
R304.5.3

e

Compliance Description N/A Ramp Length (in) Yes Ramp Width (in) N/A Flare Type LT N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A Landing Length (in) N/A Landing Width (in) N/A Landing Slope (%) N/A Landing X Slope (%) N/A Landing Curb? (Y/N) N/A Shared Landing? N/A **Gutter Ponding?** N/A Gutter Lip Ht (in) N/A Painted X Walk1? X Walk 1 Direction N/A X Walk 1 Width (in) N/A

Total Cost: \$ 3200.00

| | X Walk 1 Slope (%) | 2.1 | | X Walk 2 Slope (%) | 6.6 |
|-----|----------------------|-----|-----|-----------------------------|------|
| | X Walk 1 X Slope (%) | 5.5 | | X Walk 2 X Slope (%) | 1.9 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 4.3 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 4.6 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | | | |





