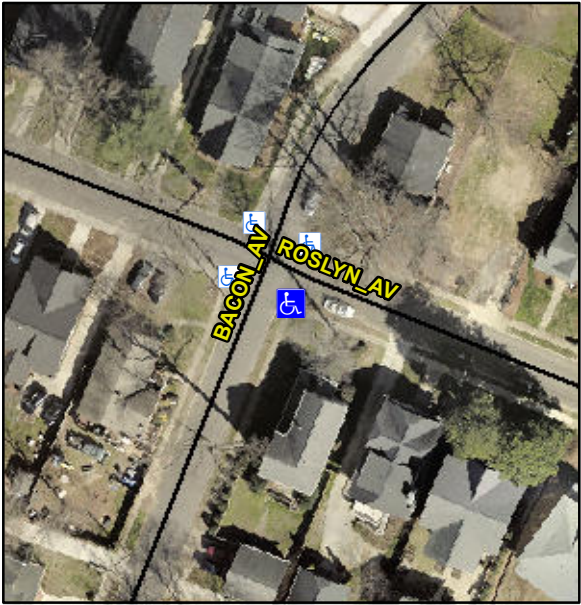


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10181	Main Street: BACON_AV	Cross Street: ROSLYN_AV	Location: S
ADA ID: 5DE6902BDCB5	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 47.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	85.5
			No	Ramp Width (in)	28.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To NE
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.7
				X Walk 1 X Slope (%)	2.6
			N/A	Ramp inside XWalk1?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.3</p>			N/A	Ramp Slope (%)	6.4
			No	Ramp XSlope (%)	6.3
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk2?	No
				X Walk 2 Direction	To NW
			N/A	X Walk 2 Width (in)	N/A
				X Walk 2 Slope (%)	2.8
				X Walk 2 X Slope (%)	4.9
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

