cole

Access Compliance Report Public Rights-of-Way (Curb Ramps)



| Intersection ID: 48313 | Main Str | Main Street: RIBBONWALK_TL | | | Cross Street: TRILLIUM_FIELDS_DR | | | | Ν |
|--|---------------------|---|------------|--|----------------------------------|------|-----------------------------|-----------------------------|-------|
| ADA ID: 608FE1437807 | Ramp Type: PerpDiag | | | Initial Pass/Fail: Fail Overall Compliance: No | | | | o Severity Score: | 33.75 |
| Codes/Mitigation Info/Possible Solution | | | | Field Measurements/Component Compliance | | | | | |
| | | Possible Solutions: | | Compliance Description | | | Data Compliance Description | | |
| | | Remove & Replace Curb Ra | amn With | N/A | Ramp Length (in) | 48.5 | Yes | Ramp Slope (%) | 5.4 |
| | | Two New Directional Ramps of Equivalent. | • | No | Ramp Width (in) | 46.5 | No | Ramp XSlope (%) | 7.1 |
| | | | | N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| and the second | | | | N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| | | | | N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| | | 4 | | N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| No. Com | | Surveyor Notes: | | N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| Prote | | N/A | | N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| S.S. S. | | | | N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| | | | | N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| | | | | N/A | Shared Landing? | N/A | | | |
| | Dent Pain | PROW/ADA: | | N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| 1 this Pray | THOMAS & | Not Found, R304.5.1, R304.5.3 | 53 | N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| | | | .0.0 | N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| NO DE CONTRACTOR OF THE OWNER OF | | | | | X Walk 1 Direction | To S | | X Walk 2 Direction | To E |
| | | | | N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| Street 1 Name | RIBBONWALK TL | | | | X Walk 1 Slope (%) | 4.2 | | X Walk 2 Slope (%) | 6.5 |
| Stop Condition-Street 2 | None | | | | X Walk 1 X Slope (%) | 5.1 | | X Walk 2 X Slope (%) | 2.5 |
| Street 2 Name | TRILLIUM FIELDS DR | | | N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| Stop Condition-Street 1 | StopSign | | | | Road Slope (%) | 5.1 | N/A | Clear Space? | N/A |
| | . • 5 | | | | Road X Slope (%) | 0.2 | N/A | Clear Space to XWalk (in) | N/A |
| | | | | N/A | Any Obstructions? | N/A | | Storm Grate/Utility Hazard? | N/A |
| | | Total Cost: | \$ 3200.00 | | Obstruction Type | | | Storm Grate/Utility Type | |
| | | | | | 2. | N/A | | | N/A |
| | | | | | | | | | |

Yes Surface Condition? (G/P)

Good





