cole

Access Compliance Report Public Rights-of-Way (Curb Ramps)



| Intersection ID: 30632 Main Street: PROVIDENCE_RD_WEST | | | | Cross Street: DIXIE_HILLS_DR | | | | Location: | NE |
|--|---------------------------|---------------------------|---------|---|-----------------------|------------|-----------------------------|-----------------------------|------------|
| ADA ID: 74DED2BFBE63 Ramp Type: PerpDiag | | | Initial | nitial Pass/Fail: Fail Overall Compliance: No | | | | o Severity Score: | 21.25 |
| Codes/Mitigation Info/Possible Solution | | | | Field Measurements/Component Compliance | | | | | |
| | | Possible Solutions: | | Compliance Description | | | Data Compliance Description | | Data |
| Contraction of the second | | Remove & Replace Curb R | np With | N/A | Ramp Length (in) | 57.0 | Yes | Ramp Slope (%) | 6.7 |
| A DALLY | | Two New Directional Ramps | | No | Ramp Width (in) | 47.0 | No | Ramp XSlope (%) | 6.0 |
| 2 | | Equivalent. | | N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| | it- the state | | | N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| | A ANDREAM | | | N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| | Contraction of the second | | | N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| | | Surveyor Notes: | | N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| | E C | N/A | | N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| | | | | N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| | | | | N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| | | | | N/A | Shared Landing? | N/A | | | |
| Pisou | PROW/ADA: | | N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A | |
| Not Found, R304.5.1, R304.5.3 | | | 3 | N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| | | | .5 | N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | | | | | X Walk 1 Direction | To W | | X Walk 2 Direction | To S |
| | | | | N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| Street 1 Name | DIXIE HILLS DR | 8. | | 10/4 | X Walk 1 Slope (%) | 0.1 | | X Walk 2 Slope (%) | 3.9 |
| Stop Condition-Street 2 | StopSign | | | | X Walk 1 X Slope (%) | 6.0 | | X Walk 2 X Slope (%) | 5.9 5.0 |
| Street 2 Name | PROVIDENCE RD WEST | | | N/A | Ramp inside XWalk1? | 0.0 N/A | N/A | Ramp inside XWalk2? | 0.0 N/A |
| Stop Condition-Street 1 | None | | | 11/2 | Road Slope (%) | 4.4 | N/A | Clear Space? | N/A |
| Stop Condition-Street | None | | | | , | | N/A | • | N/A N/A |
| | | | | N1/A | Road X Slope (%) | 3.9 | | Clear Space to XWalk (in) | |
| | | Tatal Cast | 2000.00 | N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | | Total Cost: \$ | 3200.00 | | Obstruction Type | | | Storm Grate/Utility Type | |
| | | | | | | N/A | | | N/A |

Yes Surface Condition? (G/P)

Good

