

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11540	Main Street: W MARTIN LUTHER KING JR BV	Access Street: S SUMMIT AV	Location: S
ADA ID: 8C475D9B33A9	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 17.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

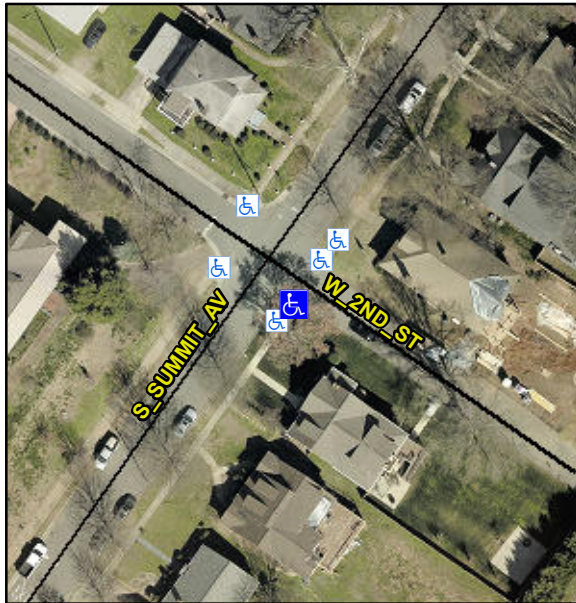

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305, R302.7.2, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	66.0	Yes	BlendTrans Slope (%)	4.5
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	1.4
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	61.5	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.4	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.4	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	5.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.2		Clear Space?	Yes
	Road X Slope (%)	5.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	7.9

Total Cost: \$ 3950.00

