


|                        |                                  |                         |                        |                       |
|------------------------|----------------------------------|-------------------------|------------------------|-----------------------|
| Intersection ID: 31122 | Main Street: MILLSTREAM_RIDGE_DR | Cross Street: N/A       | Location:              | NE                    |
| ADA ID: 946B1D07E3E6   | Ramp Type: BlendTrans1           | Initial Pass/Fail: Fail | Overall Compliance: No | Severity Score: 33.75 |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|---|---|
|---|---|

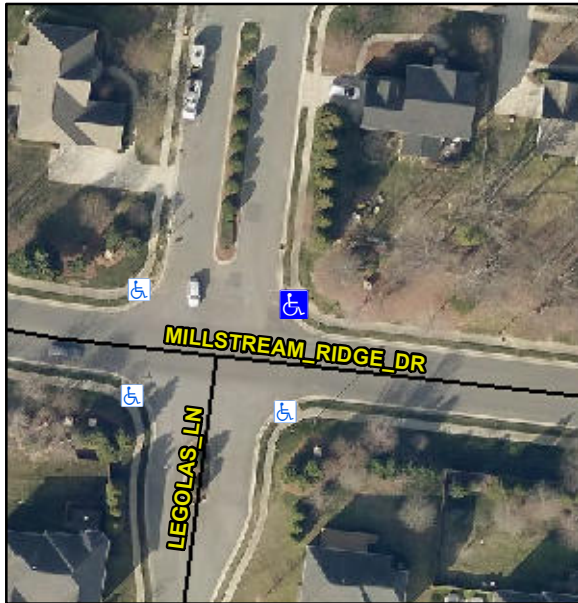

### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

| Compliance | Description           | Data | Compliance | Description                 | Data |
|------------|-----------------------|------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 49.0 | Yes        | BlendTrans Slope (%)        | 4.5  |
| No         | Ramp Width (in)       | 42.0 | No         | BlendTrans XSlope (%)       | 10.7 |
| N/A        | Flare Type LT         | N/A  | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A  | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | N/A  | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)   | N/A  | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)    | N/A  | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)     | N/A  | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)   | N/A  | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)   | N/A  | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?       | N/A  |            |                             |      |
| N/A        | Gutter Ponding?       | N/A  | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)    | 1.0  | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?      | No   | N/A        | Painted X Walk2?            | No   |
|            | X Walk 1 Direction    | To W |            | X Walk 2 Direction          | To S |
|            | X Walk 1 Width (in)   | N/A  |            | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 8.6  |            | X Walk 2 Slope (%)          | 8.4  |
|            | X Walk 1 X Slope (%)  | 9.1  |            | X Walk 2 X Slope (%)        | 2.3  |
| N/A        | Ramp inside XWalk1?   | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | 10.1 |            | Clear Space?                | N/A  |
|            | Road X Slope (%)      | 0.6  | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?     | N/A  | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type      |      |            | Storm Grate/Utility Type    |      |
|            |                       | N/A  |            |                             | N/A  |
|            |                       |      | Yes        | Surface Condition? (G/P)    | Good |
|            |                       |      | No         | Curb Slope (%)              | 21.9 |

Total Cost: \$ 3200.00

