

## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

9.2

2.6

N/A

Yes

To SW

111.0

2.3

1.0

Yes

N/A

N/A

N/A

N/A

Good

Intersection ID: 12431 Main Street: S\_CHURCH\_ST Cross Street: W\_MARTIN\_LUTHER\_KING\_JR\_BV Location: E

ADA ID: A43CC81C90A8 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

No

No

N/A

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

**DWS Provided?** 

**DWS Contrast?** 

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Data

60.0

49.0

N/A

Yes

88.0

4.0

0.5

Yes

To NW



Street 1 Name S CHURCH ST
Stop Condition-Street 2 Signal
Street 2 Name W MARTIN LUTHER KING JR BV
Stop Condition-Street 1 Signal

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.2.2, R304.5.3

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost: \$ 3200.00

Yes Ramp Width (in) N/A Flare Type LT N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A Landing Length (in) N/A Landing Width (in) N/A Landing Slope (%) N/A Landing X Slope (%) N/A Landing Curb? (Y/N) N/A Shared Landing? N/A **Gutter Ponding?** N/A Gutter Lip Ht (in) N/A Painted X Walk1? X Walk 1 Direction N/A X Walk 1 Width (in) X Walk 1 Slope (%) X Walk 1 X Slope (%) N/A Ramp inside XWalk1? N/A

N/A

Compliance Description

Ramp Length (in)

Road Slope (%)
Road X Slope (%)
5.5

I/A Any Obstructions?
Obstruction Type

N/A





