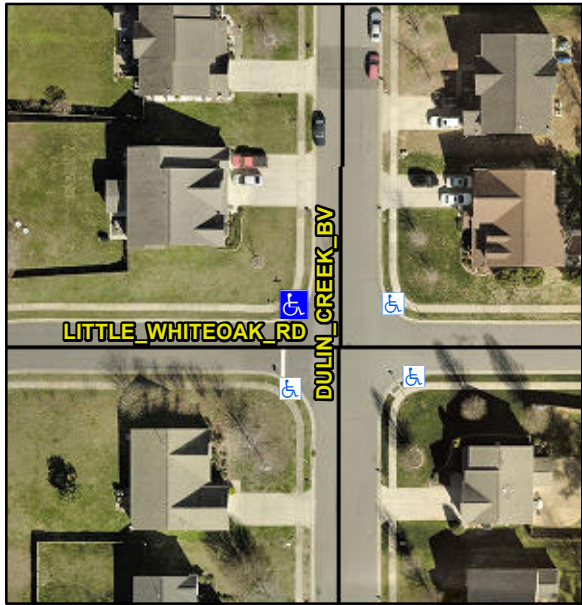


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 45134	Main Street: DULIN_CREEK_BV	Cross Street: LITTLE_WHITEOAK_RD	Location: NW
ADA ID: DB5E9C439195	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 47.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 Name<div>LITTLE WHITEOAK RD</div></div> <div>Stop Condition-Street 1<div>StopSign</div></div> <div>Street 2 Name<div>DULIN CREEK BV</div></div> <div>Stop Condition-Street 2<div>None</div></div>	Possible Solutions:		Compliance			Compliance		
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	49.5	Yes	BlendTrans Slope (%)	1.4
			No	Ramp Width (in)	30.0	No	BlendTrans XSlope (%)	5.9
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To S		X Walk 2 Direction	To E	
			X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	5.2	
			X Walk 1 X Slope (%)	3.7		X Walk 2 X Slope (%)	0.5	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	3.3		Clear Space?	N/A	
			Road X Slope (%)	4.5	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
					No	Curb Slope (%)	11.1	

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

