


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 3137 Main Street: ALAMEDA\_LN Cross Street: STONE\_PARK\_DR Location: SE

ADA ID: 01E629ED1EFF Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

## Codes/Mitigation Info/Possible Solution

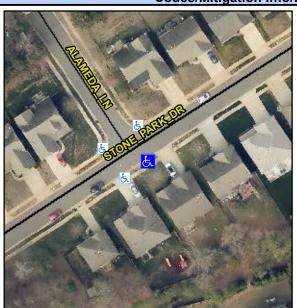

Street 1 Name	STONE PARK DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:	0
Remove & Replace Entire Ramp.	N
	Υ
	N
	N
	N
	N
Surveyor Notes:	N
N/A	N
	N
	N
	N
PROW/ADA:	N
Not Found, R304.2.2, R304.5.3	N
	N
	N

100			5
-			
500	or Control		000



Total Cost:



1850.00

Field Measurements/Component Compliance						
Compl	iance Description	Data	Comp	liance l	Description	Data
N/A	Ramp Length (in)	46.5	No	Ramp	Slope (%)	8.6
Yes	Ramp Width (in)	48.0	No	Ramp 2	XSlope (%)	2.1
N/A	Flare Type LT	N/A	N/A	Flare T	ype RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare S	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare T	raversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS F	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS C	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS L	ength (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS F	ull Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS (	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter	Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter	X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted	d X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk	2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk	2 Width (in)	N/A
	X Walk 1 Slope (%)	5.0		X Walk	2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.9		X Walk	2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear S	Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear S	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm	Grate/Utility Hazard?	N/A
	Obstruction Type			Storm	Grate/Utility Type	
		N/A				N/A
			Yes	Surface	e Condition? (G/P)	Good