


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10570	Main Street: HERRIN_AV	Cross Street: HOLT_ST	Location: NW
ADA ID: 075B3326148B	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
-----------------------------------------	-----------------------------------------

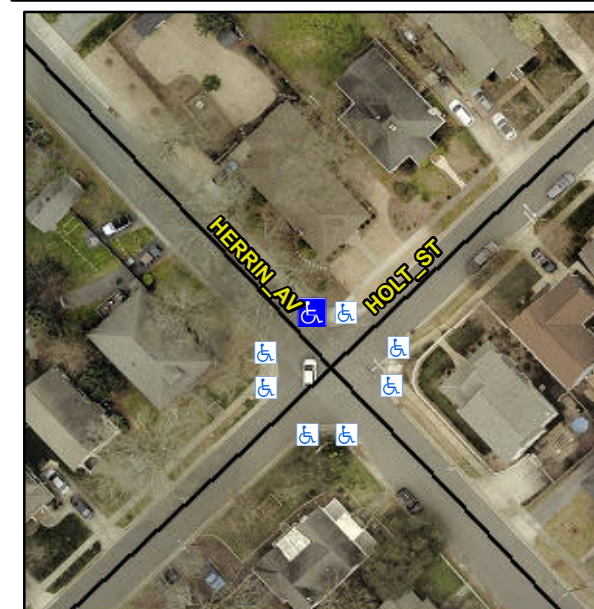

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.3.2, R304.5.3

Total Cost:

\$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	62.5	N/A	Ramp Length RT (in)	47.0
Yes	Ramp Width LT (in)	48.0	Yes	Ramp Width RT (in)	48.0
Yes	Ramp Slope LT (%)	1.5	No	Ramp Slope RT (%)	9.5
Yes	Ramp XSlope LT (%)	1.8	No	Ramp XSlope RT (%)	2.1
N/A	Ramp Length (in)	27.0	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
					N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	18.0

