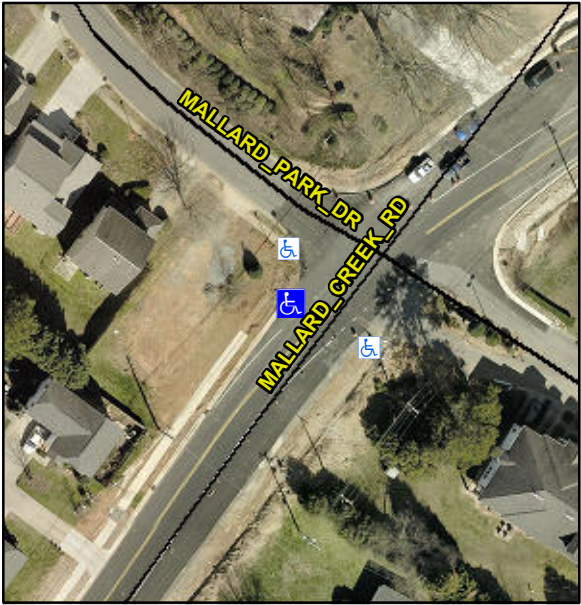



# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 5598	Main Street: MALLARD_CREEK_RD	Cross Street: MALLARD_PARK_DR	Location: W
ADA ID: 08414E32E16B	Ramp Type: Combination2	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	53.5
			Yes	Ramp Width LT (in)	59.5
			No	Ramp Slope LT (%)	8.4
			No	Ramp XSlope LT (%)	2.7
			N/A	Ramp Length (in)	36.0
			Yes	Ramp Width (in)	48.0
	Surveyor Notes:		N/A	Flare Type LT	N/A
	N/A		N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
<p>PROW/ADA:</p> <p><b>Not Found, R304.2.2, R304.5.3, R304.3.2</b></p>			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To SE
<p>Total Cost: \$ 1600.00</p>			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	5.8
				X Walk 1 X Slope (%)	2.5
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
				Road X Slope (%)	N/A
			N/A	Ramp inside XWalk2?	N/A
				Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	9.8