

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 12548 Main Street: E_MARTIN_LUTHER_KING_JR_CBVss Street: S_TRYON_ST Location: S

ADA ID: 08BDC07BE3FD Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

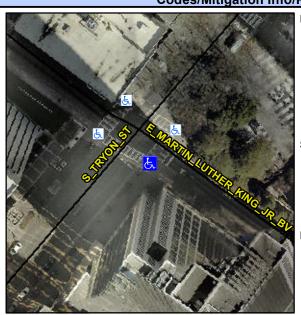

Street 1 Name E MARTIN LUTHER KING JR BV
Stop Condition-Street 2 Signal
Street 2 Name S TRYON ST
Stop Condition-Street 1 Signal

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.2.2, R304.5.3

Total Cost: \$ 3200.00

| Compliance Description | | Data | Compliance Description | | Data |
|------------------------|-----------------------|-------|------------------------|-----------------------------|-------|
| N/A | Ramp Length (in) | 77.0 | No | Ramp Slope (%) | 9.1 |
| No | Ramp Width (in) | 40.0 | No | Ramp XSlope (%) | 5.9 |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | Yes |
| | X Walk 1 Direction | To NE | | X Walk 2 Direction | To NW |
| N/A | X Walk 1 Width (in) | 195.0 | N/A | X Walk 2 Width (in) | 105.0 |
| | X Walk 1 Slope (%) | 2.2 | | X Walk 2 Slope (%) | 1.2 |
| | X Walk 1 X Slope (%) | 0.0 | | X Walk 2 X Slope (%) | 1.7 |
| N/A | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | Yes |
| | Road Slope (%) | 0.7 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 1.4 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | l | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | I | | |

Yes

Surface Condition? (G/P)

Good





