


Access Compliance Report Public Rights-of-Way (Curb Ramps)

| | | | |
|---|------------------------|---|------------------------|
| Intersection ID: 10037598 | Main Street: SENECA_PL | Cross Street: N/A | Location: NW |
| ADA ID: 08DC3023A8ED | Ramp Type: ParaDiag | Initial Pass/Fail: Fail | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution | | | Severity Score: 25 |
| | | Field Measurements/Component Compliance | |

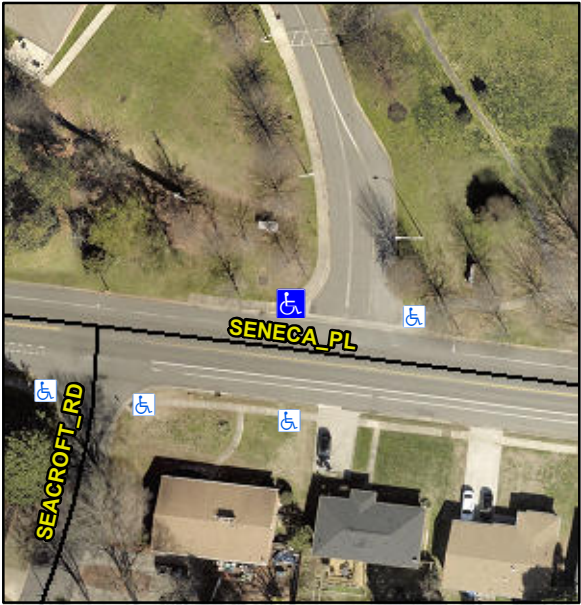

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
LT RP < 5%

PROW/ADA:
R304.3.2

| | |
|-------------------------|------------------|
| Street 1 Name | SENECA PL |
| Stop Condition-Street 1 | None |
| Street 2 Name | ENTRANCE |
| Stop Condition-Street 2 | StopSign |

Total Cost: \$ **3200.00**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|----------------------|------|------------|-----------------------------|------|
| N/A | Ramp Length LT (in) | 56.0 | N/A | Ramp Length RT (in) | 56.0 |
| Yes | Ramp Width LT (in) | 59.0 | Yes | Ramp Width RT (in) | 60.0 |
| Yes | Ramp Slope LT (%) | 4.6 | No | Ramp Slope RT (%) | 13.9 |
| Yes | Ramp XSlope LT (%) | 0.8 | Yes | Ramp XSlope RT (%) | 1.5 |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To S | | X Walk 2 Direction | To E |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 5.5 | | X Walk 2 Slope (%) | 0.8 |
| | X Walk 1 X Slope (%) | 1.0 | | X Walk 2 X Slope (%) | 5.0 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 4.1 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 2.9 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | N/A | Curb Slope (%) | 14.2 |

