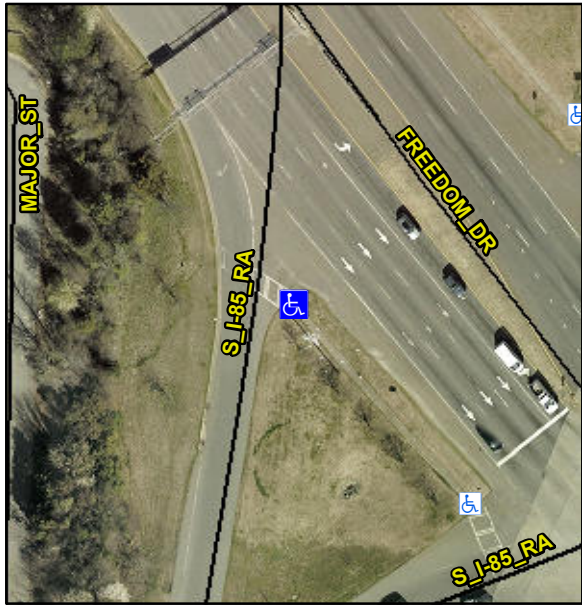


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: FREEDOM_DR	Cross Street: S_I-85_RA	Location: S
ADA ID: 08F4AD2832A2	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance											
<div></div> <div>Street 1 NameS I-85 RA</div> <div>Stop Condition-Street 1None</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>		Possible Solutions:		Compliance		Description		Data	Compliance		Description		Data
		Install Detectable Warning System.		N/A	Ramp Length (in)	60.0	Yes	BlendTrans Slope (%)	0.8				
		Surveyor Notes:  LOCATED ON ISLAND		Yes	Ramp Width (in)	60.0	Yes	BlendTrans XSlope (%)	3.5				
				N/A	Flare Type LT	None	N/A	Flare Type RT	None				
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A				
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A				
				Yes	Landing Length (in)	60.0	No	DWS Provided?	No				
				Yes	Landing Width (in)	60.0	N/A	DWS Contrast?	No				
				Yes	Landing Slope (%)	0.3	N/A	DWS Length (in)	N/A				
				Yes	Landing X Slope (%)	4.8	N/A	DWS Full Width?	No				
				N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A				
				N/A	Shared Landing?	No							
		PROW/ADA:  R305		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.7				
				Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	3.4				
				N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A				
					X Walk 1 Direction	To NW		X Walk 2 Direction	N/A				
					X Walk 1 Width (in)	111.5		X Walk 2 Width (in)	N/A				
					X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A				
					X Walk 1 X Slope (%)	4.9		X Walk 2 X Slope (%)	N/A				
				Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A				
					Road Slope (%)	4.9		Clear Space?	Yes				
					Road X Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A				
		Total Cost: \$ 235.00		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No				
					Obstruction Type			Storm Grate/Utility Type					
						N/A			N/A				
							Yes	Surface Condition? (G/P)	Good				
							Yes	Curb Slope (%)	1.4				

