

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 26681	Main Street: COUNTRY_LN	Cross Street: LOMA_LINDA_LN	Location:	E
ADA ID: 0B4D7BAE4BA5	Ramp Type: MedianPerp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 2.5

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

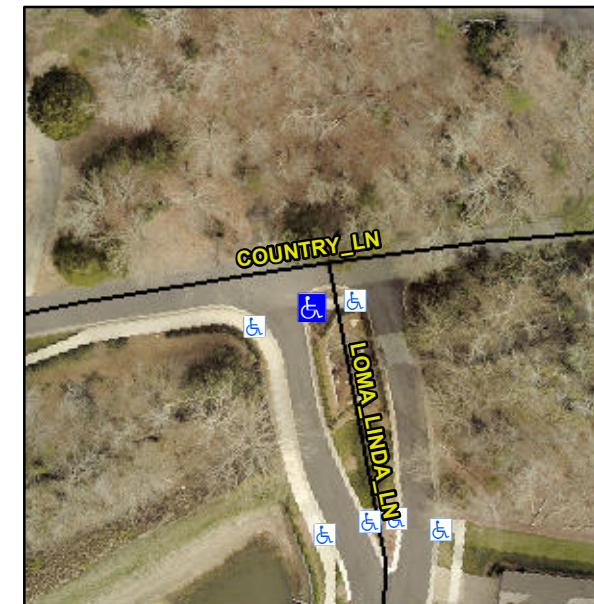

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R305.1.4, R305.2, R302.7**

Total Cost: \$ 1650.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	7.1
Yes	Ramp Width (in)	63.0	Yes	Ramp XSlope (%)	0.8
Yes	Flare Type LCurbed_NoWalkSurface		Yes	Flare Type RT	N/A
Yes	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	27.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	63.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset (in)	6.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	1.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name LOMA LINDA LN

Stop Condition-Street 2 None

Street 2 Name N/A

Stop Condition-Street 1 N/A

