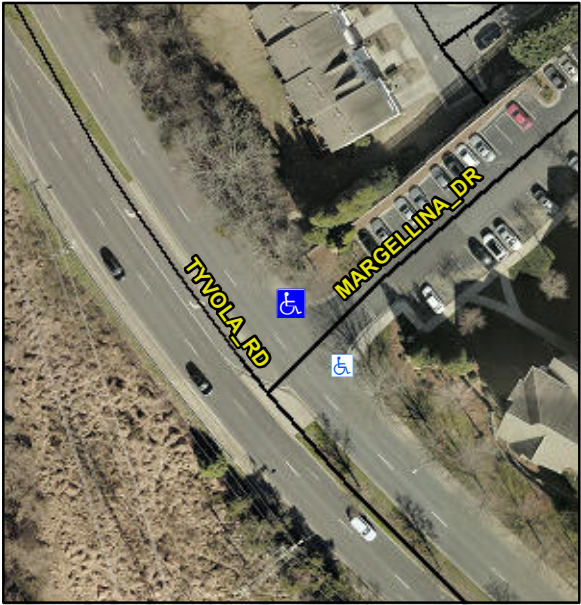


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46315	Main Street: TYVOLA_RD	Cross Street: MARGELLINA_DR	Location: N
ADA ID: 0EA59EC90DC6	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length LT (in)	44.0
			Yes	Ramp Width LT (in)	59.5
			Yes	Ramp Slope LT (%)	3.7
			Yes	Ramp XSlope LT (%)	0.0
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>MEDIAN ACROSS TYVOLA RD, LT RP < 5%</p> <p>PROW/ADA:</p> <p>R304.3.2, R304.5.3</p>			N/A	Ramp Length RT (in)	54.0
			Yes	Ramp Width RT (in)	60.0
			No	Ramp Slope RT (%)	16.3
			No	Ramp XSlope RT (%)	2.6
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Gutter X Slope (%)	N/A
			No	Painted X Walk2?	No
			To SW	X Walk 2 Direction	To SE
			N/A	X Walk 2 Width (in)	N/A
			6.5	X Walk 2 Slope (%)	3.5
			4.8	X Walk 2 X Slope (%)	2.7
			N/A	Ramp inside XWalk2?	N/A
			7.4	Clear Space?	N/A
			3.1	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
<p>Obstruction Type</p>			N/A	Storm Grate/Utility Type	N/A
			N/A	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.1

