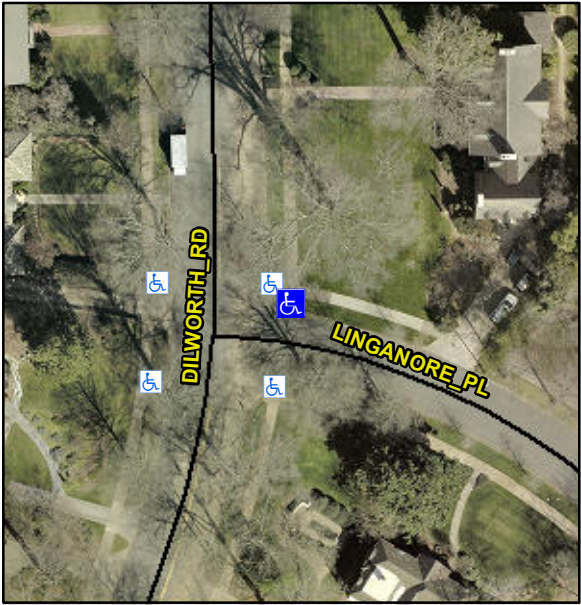


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 14471	Main Street: DILWORTH_RD	Cross Street: LINGANORE_PL	Location: NE
ADA ID: 0FD7278D929A	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 13.75			

	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	R304.2.2, R304.5.3				
	Street 1 Name	LINGANORE PL			
	Stop Condition-Street 1	StopSign			
	Street 2 Name	N/A			
	Stop Condition-Street 2	N/A			
Total Cost:		\$	1600.00		
		Compliance	Description	Data	Compliance
		Description			Description
		Data			Data
		N/A	Ramp Length (in)	57.0	N/A
		Yes	Ramp Width (in)	65.0	N/A
		No	Ramp Slope (%)	9.3	N/A
		No	Ramp XSlope (%)	4.8	N/A
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	0.0	N/A
		N/A	Landing Width (in)	0.0	N/A
		N/A	Landing Slope (%)	0.0	N/A
		N/A	Landing X Slope (%)	0.0	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	N/A
		N/A	Gutter Ponding?	0.0	N/A
		N/A	Gutter Lip Ht (in)	0.0	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To S	N/A
			X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	3.7	N/A
			X Walk 1 X Slope (%)	2.4	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		N/A
		Yes	Surface Condition? (G/P)	Good	Good
		N/A	Curb Slope (%)	10.3	10.3

