

## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)




Intersection ID: N/A Location: S

ADA ID: 1545ECD0F6C1 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 12.5

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

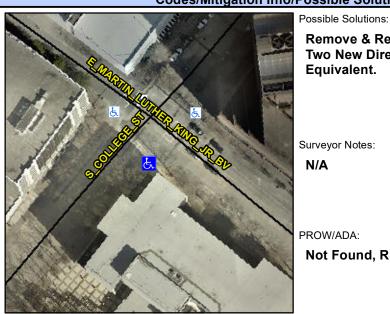

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2

treet 1 Name	E MARTIN LUTHER KING JR BV
top Condition-Street 2	Signal
treet 2 Name	S COLLEGE ST
top Condition-Street 1	Signal

Total Cost: 3200.00

Compliance Description Data		Data	Comp	liance Description	Data
N/A	Ramp Length (in)	44.0	No	Ramp Slope (%)	8.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	113.0	N/A	X Walk 2 Width (in)	112.0
	X Walk 1 Slope (%)	6.4		X Walk 2 Slope (%)	3.8
	X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	5.2
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.5	N/A	Clear Space?	N/A
	Road X Slope (%)	6.4	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A

Yes

Surface Condition? (G/P)

Good





