

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                              |                                        |                        |
|------------------------|------------------------------|----------------------------------------|------------------------|
| Intersection ID: 25405 | Main Street: MARMOT_POINT_LN | Cross Street: PROVIDENCE_PLANTATION_LN | Location: NW           |
| ADA ID: 168D562C6C04   | Ramp Type: BlendTrans1       | Initial Pass/Fail: Fail                | Overall Compliance: No |
|                        |                              | Severity Score: 47.5                   |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

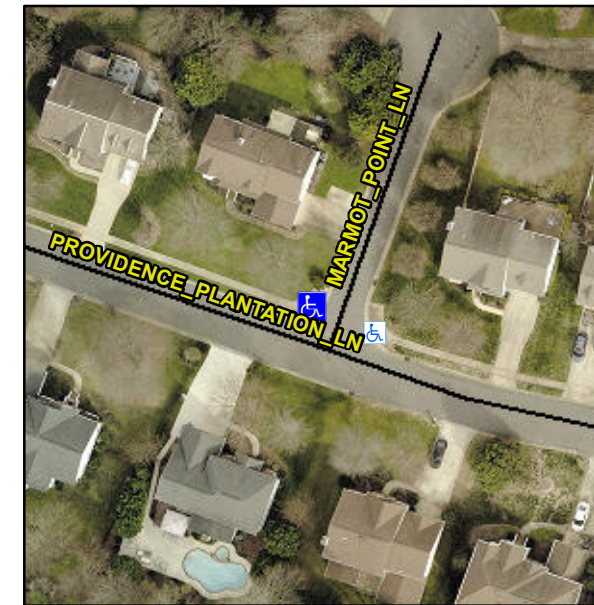

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

Total Cost: \$ 3200.00

| Compliance | Description           | Data  | Compliance | Description                 | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 96.0  | Yes        | BlendTrans Slope (%)        | 3.4  |
| No         | Ramp Width (in)       | 29.0  | No         | BlendTrans XSlope (%)       | 6.9  |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?       | N/A   |            |                             |      |
| N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?      | No    | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction    | To SE |            | X Walk 2 Direction          | N/A  |
|            | X Walk 1 Width (in)   | N/A   |            | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 0.0   |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%)  | 4.3   |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?   | N/A   | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | 4.3   |            | Clear Space?                | N/A  |
|            | Road X Slope (%)      | 0.0   | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |      |
|            |                       | N/A   |            |                             | N/A  |
|            |                       |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                       |       | No         | Curb Slope (%)              | 11.6 |

