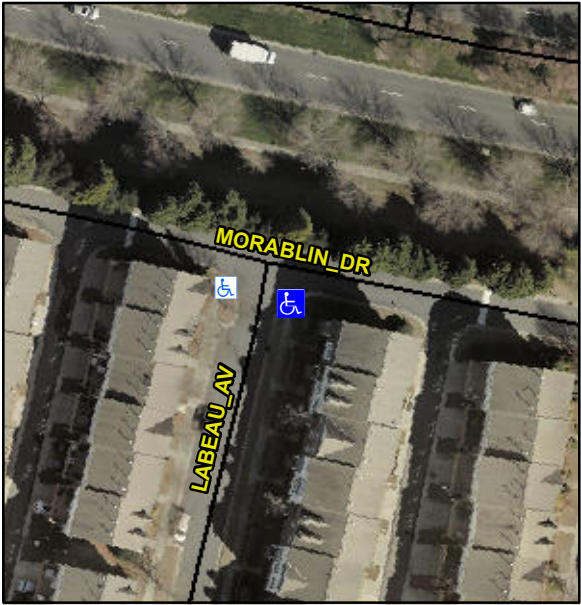


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: LABEAU_AV	Cross Street: MORABLIN_DR	Location: SE
ADA ID: 16CEFD5562EC	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length (in)	52.0
			No	Ramp Width (in)	42.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.2.2</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To N
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.7
				X Walk 1 X Slope (%)	3.8
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	1.2
				Road X Slope (%)	8.4
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

