

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                        |                               |                        |
|------------------------|------------------------|-------------------------------|------------------------|
| Intersection ID: 21411 | Main Street: MONROE_RD | Cross Street: SARDIS_RD_NORTH | Location: NW           |
| ADA ID: 1AC346BA0BAE   | Ramp Type: Para        | Initial Pass/Fail: Fail       | Overall Compliance: No |
|                        |                        | Severity Score: 12.5          |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

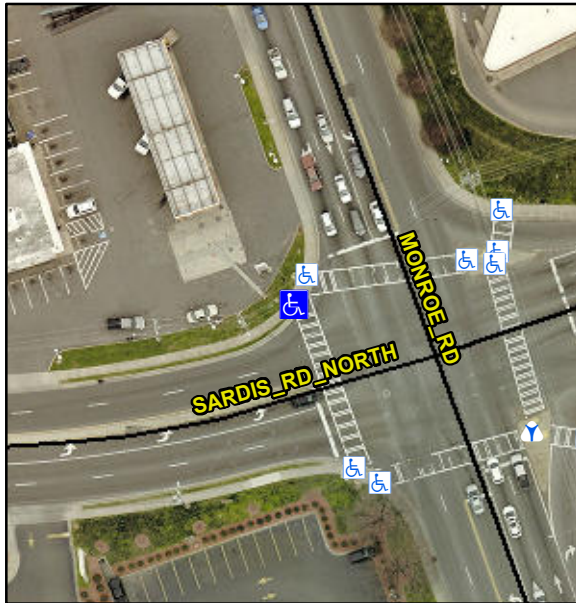

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.3.2**

|                         |                        |
|-------------------------|------------------------|
| Street 1 Name           | <b>SARDIS RD NORTH</b> |
| Stop Condition-Street 1 | <b>Signal</b>          |
| Street 2 Name           | <b>N/A</b>             |
| Stop Condition-Street 2 | <b>N/A</b>             |

Total Cost: \$ 1600.00

| Compliance | Description          | Data  | Compliance | Description                 | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length LT (in)  | 63.0  | N/A        | Ramp Length RT (in)         | 65.0 |
| Yes        | Ramp Width LT (in)   | 72.0  | Yes        | Ramp Width RT (in)          | 71.0 |
| No         | Ramp Slope LT (%)    | 8.5   | Yes        | Ramp Slope RT (%)           | 5.2  |
| Yes        | Ramp XSlope LT (%)   | 1.2   | Yes        | Ramp XSlope RT (%)          | 1.5  |
| N/A        | Landing Length (in)  | N/A   | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)   | N/A   | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)    | N/A   | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)  | N/A   | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)  | N/A   | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?      | N/A   |            |                             |      |
| N/A        | Gutter Ponding?      | N/A   | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)   | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?     | Yes   | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction   | To SE |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)  | 110.0 | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)   | 0.0   |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%) | 0.6   |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?  | Yes   | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)       | N/A   | N/A        | Clear Space?                | N/A  |
|            | Road X Slope (%)     | N/A   | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?    | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type     |       |            | Storm Grate/Utility Type    |      |
|            |                      | N/A   |            |                             | N/A  |
|            |                      |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                      |       | N/A        | Curb Slope (%)              | 6.8  |

