

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

54.0

71.5

2.6

2.3

7.7

2.3

N/A

Intersection ID: N/A Main Street: HICKORY GROVE RD Cross Street: SUSAN DR Location: NW Initial Pass/Fail: Fail **Overall Compliance: No** 22.5 **ADA ID: 1C4BAB0FBFAB** Ramp Type: Combination1 **Severity Score:**

Compliance Description

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Gutter Lip Ht (in)

Painted X Walk1?

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

N/A

Yes

No

No

N/A

No

N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

Yes

No

Yes

Yes

N/A

No N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

Flare Traversable RT?

Ramp XSlope RT (%)

Data

51.0

71.0

8.4

4.0

72.5

47.0

N/A




Street 1 Name None **SUSAN DR** Stop Condition-Street 1 Street 2 Name N/A Stop Condition-Street 2 N/A

Possible Solutions:							
Remove & Replace Entire Ramp.							
·							
Surveyor Notes:							
N/A							
PROW/ADA:							
Not Found, R304.5.1, R304.3.2,							
R304.5.3							



Total Cost:

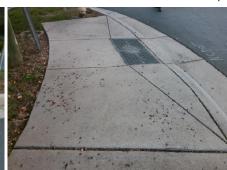

			X Walk 1 Direction	To E		X Walk 2 Direction	N/A
			X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	5.4		X Walk 2 X Slope (%)	N/A
\$	1800.00	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A		Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
1					N/A	Any Obstruction?	N/A
		1				Obstruction Type	
		A start	3				N/A
					N/A	Storm Grate/Utility Hazard?	N/A
						Storm Grate/Utility Type	1071
							N/A
					Yes	Surface Condition? (G/P)	Good
						Curb Slope (%)	6.4
No. of Lot	the second second second		Martin Committee of the last o				

