

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




 Intersection ID: 13197
 Main Street: S\_MCDOWELL\_ST
 Cross Street: E\_4TH\_ST
 Location:
 S

 ADA ID: 1DF33C5184F9
 Ramp Type: BlendTrans1
 Initial Pass/Fail: Fail
 Overall Compliance: No
 Severity Score: 12.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

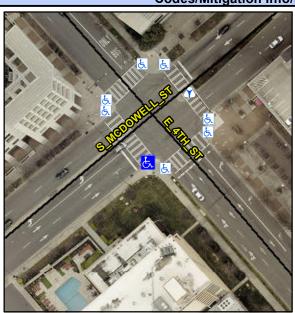

Street 1 Name S MCDOWELL ST
Stop Condition-Street 1 Signa
Street 2 Name N/A
Stop Condition-Street 2 N/A

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

Possible Solutions:

N/A

PROW/ADA:

Not Found, R304.5.3

OWELL ST							
Signal							
N/A							
N/A							



Field Measurements/Component Compliance							
Compliance Description		Description Data Compliance Description		Data			
N/A	Ramp Length (in)	59.0	Yes	BlendTrans Slope (%)	2.3		
Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	6.7		
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A		
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A		
	X Walk 1 Width (in)	184.0		X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	2.6		X Walk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	2.6		Clear Space?	N/A		
	Road X Slope (%)	3.6	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm Grate/Utility Type			
		N/A			N/A		
			Yes	Surface Condition? (G/P)	Good		
			No	Curb Slope (%)	8.2		
131							





