


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10033070 Main Street: NORTH_COMMUNITY_HOUSE_Ross Street: N/A Location: SE

ADA ID: 1E48FE084A0B Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

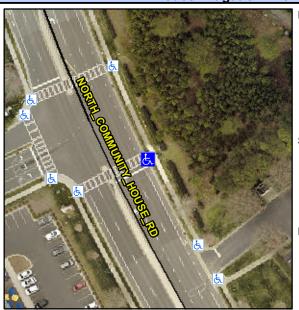

Street 1 Name NORTH COMMUNITY HOUSE RD
Stop Condition-Street 2 Signal
Street 2 Name N/A
Stop Condition-Street 1 N/A

Possible Solution	
Possible Solutions:	Con
Remove & Replace Entire Ramp.	N/A
	Yes
	N/A
	N/A
	N/A
	N/A
Surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
PROW/ADA:	N/A
Not Found, R304.2.2	N/A
	N/A
	N/A
	N/A

Total Cost:	\$ 1850.0

Field Measurements/Component Compliance							
Compl	liance Description	Data	Comp	liance	Description	Data	
N/A	Ramp Length (in)	49.0	No	Ramp	Slope (%)	9.8	
Yes	Ramp Width (in)	60.0	Yes	Ramp	XSlope (%)	2.9	
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A	
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A	
N/A	Painted X Walk1?	Yes	N/A	Paint	ed X Walk2?	N/A	
	X Walk 1 Direction	To SW		X Wa	lk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	111.0	N/A	X Wa	lk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	4.3		X Wa	lk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	3.0		X Wa	lk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp	inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm	Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm	Grate/Utility Type		
		N/A				N/A	
			Yes	Surfa	ce Condition? (G/P)	Good	





