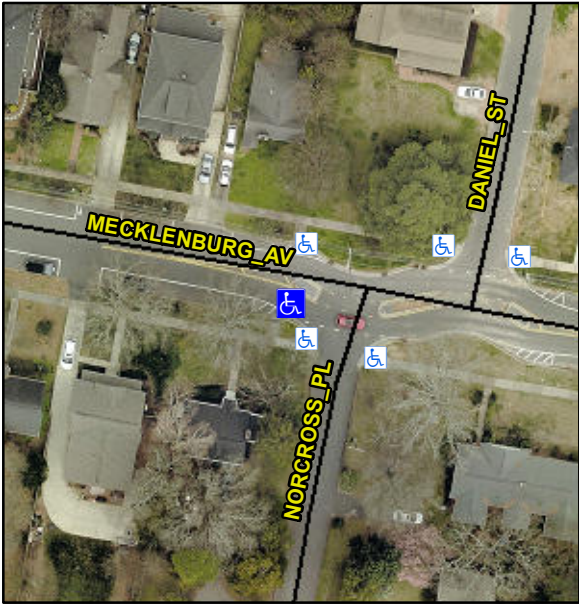


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11799	Main Street: MECKLENBURG_AV	Cross Street: NORCROSS_PL	Location: SW
ADA ID: 22C6E9608D2D	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 Name<div>MECKLENBURG AV</div></div> <div>Stop Condition-Street 1<div>None</div></div> <div>Street 2 Name<div>N/A</div></div> <div>Stop Condition-Street 2<div>N/A</div></div>	Possible Solutions:		Compliance			Compliance		
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	109.0	N/A	Grade Break?	N/A
			Yes	Ramp Width (in)	59.0	N/A	Grade Break Slope (%)	0.0
			No	Ramp Slope (%)	8.7	N/A	Grade Break XSlope (%)	0.0
			No	Ramp XSlope (%)	3.4			
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:		N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	0.0	N/A	DWS Contrast?
			N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
PROW/ADA:			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
R304.2.2, R304.5.3			N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
			N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No		Road Slope (%)	3.6
				X Walk 1 Direction	To N		Road X Slope (%)	3.0
				X Walk 1 Width (in)	N/A		Clear Space?	N/A
				X Walk 1 Slope (%)	3.6	N/A	Clear Space to XWalk (in)	N/A
				X Walk 1 X Slope (%)	3.0	N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
			N/A	Any Obstructions?	N/A			N/A
				Obstruction Type		Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	7.6
Total Cost:		\$ 1600.00						

