


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 11236	Main Street: N_CHURCH_ST	Cross Street: W_LIDDELL_ST	Location: S
ADA ID: 2492F6872CA8	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 28.75			

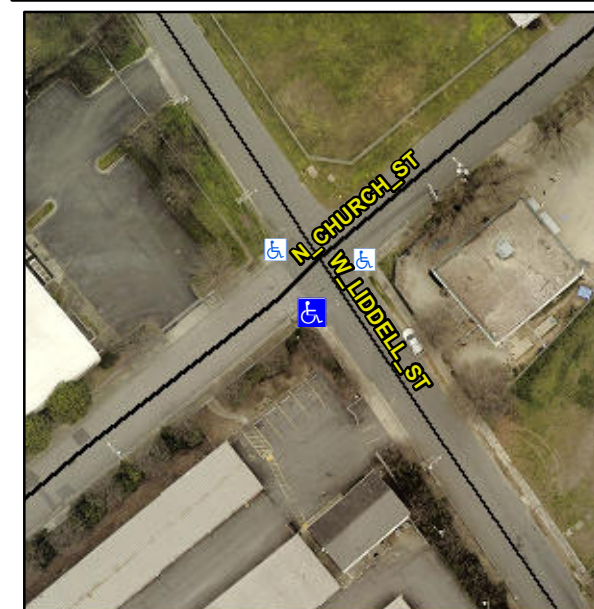

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**DAMAGED RT RAMP**

PROW/ADA:

**R304.5.3, R304.3.2, R302.7**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	73.5	N/A	Ramp Length RT (in)	60.5
Yes	Ramp Width LT (in)	71.5	Yes	Ramp Width RT (in)	59.5
Yes	Ramp Slope LT (%)	5.7	No	Ramp Slope RT (%)	9.8
No	Ramp XSlope LT (%)	3.2	Yes	Ramp XSlope RT (%)	0.3
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.6		X Walk 2 Slope (%)	2.9
	X Walk 1 X Slope (%)	4.5		X Walk 2 X Slope (%)	1.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.0	N/A	Clear Space?	N/A
	Road X Slope (%)	5.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			No	Surface Condition? (G/P)	Poor
			N/A	Curb Slope (%)	13.2

