

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 2761 Main Street: BEAUVISTA_DR Cross Street: MAPLE_COVE_LN Location: SW

ADA ID: 2BC98E0B5BCB Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

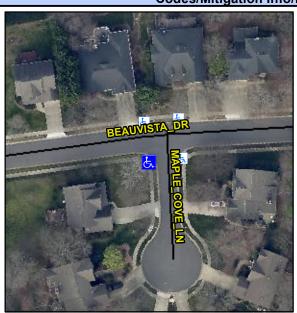

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

MAPLE COVE LN StopSign BEAUVISTA DR None Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.5.3

Total Cost: \$ 3200.00

Field Measurements/Component Compliance						
	Compliance Description		Data	Comp	oliance Description	Data
	N/A	Ramp Length (in)	42.0	Yes	Ramp Slope (%)	5.0
	No	Ramp Width (in)	39.0	No	Ramp XSlope (%)	9.6
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
	N/A	Shared Landing?	N/A			
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
		X Walk 1 Direction	To E		X Walk 2 Direction	To N
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	8.0		X Walk 2 Slope (%)	1.4
		X Walk 1 X Slope (%)	5.1		X Walk 2 X Slope (%)	7.0
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	6.9	N/A	Clear Space?	N/A
		Road X Slope (%)	5.9	N/A	Clear Space to XWalk (in)	N/A
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Obstruction Type			Storm Grate/Utility Type	
			N/A			N/A
				Yes	Surface Condition? (G/P)	Good
an a		N 100 1 100				





