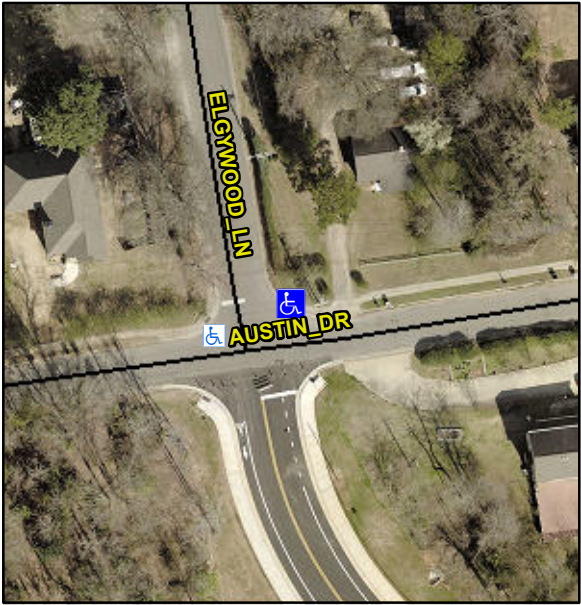


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8037	Main Street: AUSTIN_DR	Cross Street: ELGYWOOD_LN	Location: NE
ADA ID: 2FEC614FE9F9	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	23.5
			Yes	Ramp Width LT (in)	63.0
			No	Ramp Slope LT (%)	10.0
			No	Ramp XSlope LT (%)	2.5
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>RT RP < 5%, NO LT SW</p> <p>PROW/ADA:</p> <p>R304.3.2, R304.5.3</p>			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To W
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	1.2
				X Walk 1 X Slope (%)	4.4
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
<p>Total Cost:</p> <p>\$ 1600.00</p>			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		
<p>Street 1 Name</p> <p>ELGYWOOD LN</p> <p>Stop Condition-Street 1</p> <p>StopSign</p> <p>Street 2 Name</p> <p>N/A</p> <p>Stop Condition-Street 2</p> <p>N/A</p>			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	
			N/A		
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	29.8

