

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 22474 Main Street: DENMARK RD Cross Street: E_HEBRON_ST Location: NW ADA ID: 310D8274EFF7 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 25

Codes/Mitigation Info/Possible Solution

None

Field Measurements/Component Compliance

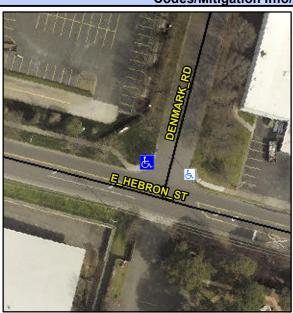

E HEBRON ST Street 1 Name Stop Condition-Street 2 Street 2 Name **DENMARK RD** Stop Condition-Street 1 StopSign Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.3

Total Cost: 3200.00

| Field Measurements/Component Compliance | | | | | |
|---|-----------------------|-------|------------------------|-----------------------------|-------|
| Compliance Description | | Data | Compliance Description | | Data |
| N/A | Ramp Length (in) | 27.0 | Yes | Ramp Slope (%) | 6.5 |
| Yes | Ramp Width (in) | 48.0 | No | Ramp XSlope (%) | 7.6 |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | To SE |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 2.6 | | X Walk 2 Slope (%) | 6.9 |
| | X Walk 1 X Slope (%) | 9.4 | | X Walk 2 X Slope (%) | 2.2 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 4.5 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 5.5 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | l | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | | | |





