


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 4270		Main Street: N_TRYON_ST		Cross Street: SALOME_CHURCH_RD		Location:		SE									
ADA ID: 3802610D74D1		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 0									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
<div></div> <div>Street 1 NameSALOME CHURCH RD</div> <div>Stop Condition-Street 1StopSign</div> <div>Street 2 NameN/A</div> <div>Stop Condition-Street 2N/A</div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Gutter.		N/A		Ramp Length (in)		73.0		Yes		Grade Break?		Yes	
						Yes		Ramp Width (in)		66.0		Yes		Grade Break Slope (%)		0.0	
						Yes		Ramp Slope (%)		6.7		Yes		Grade Break XSlope (%)		1.1	
						Yes		Ramp XSlope (%)		0.4							
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A	
						N/A		Flare Slope LT (%)		14.3		N/A		Flare Slope RT (%)		4.9	
						N/A		Flare Traversable LT?		No		N/A		Flare Traversable RT?		No	
						Yes		Landing Length (in)		60.0		Yes		DWS Provided?		Yes	
						Yes		Landing Width (in)		72.0		Yes		DWS Contrast?		Yes	
		Yes		Landing Slope (%)		2.0		Yes		DWS Length (in)		25.0					
		Yes		Landing X Slope (%)		0.2		Yes		DWS Full Width?		Yes					
		N/A		Landing Curb? (Y/N)		N/A		Yes		DWS Offset LT (in)		52.0					
		N/A		Shared Landing?		Yes		Yes		DWS Offset RT (in)		0.0					
		No		Gutter Ponding?		Yes		Yes		Gutter Slope (%)		1.7					
		Yes		Gutter Lip Ht (in)		0.0		No		Gutter X Slope (%)		3.6					
		N/A		Painted X Walk1?		No				Road Slope (%)		6.4					
				X Walk 1 Direction		To E				Road X Slope (%)		3.6					
				X Walk 1 Width (in)		N/A				Clear Space?		Yes					
				X Walk 1 Slope (%)		6.4		N/A		Clear Space to XWalk (in)		N/A					
				X Walk 1 X Slope (%)		3.6		Yes		Storm Grate/Utility Hazard?		No					
		N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type							
		Yes		Any Obstructions?		No						N/A					
				Obstruction Type				Yes		Surface Condition? (G/P)		Good					
								N/A		N/A		Curb Slope (%)		N/A			
				Total Cost:		\$ 750.00											

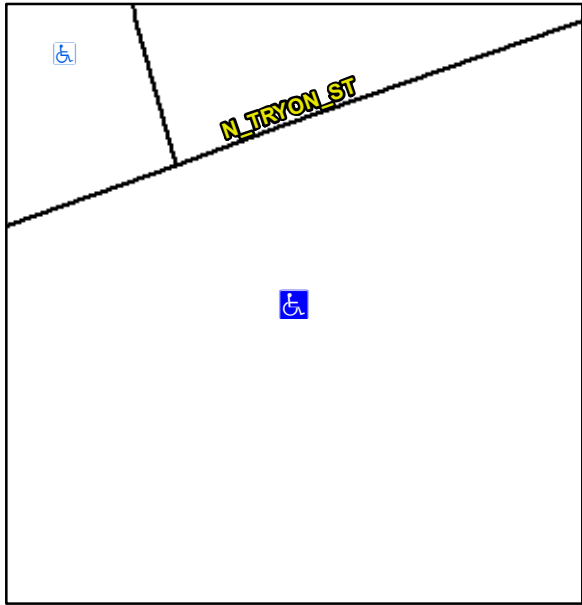