


Intersection ID: 29432	Main Street: MIRTH_LN	Cross Street: PALESTRINA_RD	Location:	SW
ADA ID: 3959A2CA0D96	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
<p>1. <b>Code 100</b>: No visible signs of mold or moisture.</p> <p>2. <b>Code 101</b>: Minor moisture detected, no mold.</p> <p>3. <b>Code 102</b>: Moderate moisture detected, no mold.</p> <p>4. <b>Code 103</b>: Significant moisture detected, no mold.</p> <p>5. <b>Code 104</b>: Significant moisture detected, mold present.</p> <p>6. <b>Code 105</b>: Significant moisture detected, mold present, and structural damage.</p>	<p>1. <b>Moisture Readings</b>: 0-10% (Dry), 11-20% (Minor), 21-30% (Moderate), 31-40% (Significant).</p> <p>2. <b>Mold Readings</b>: 0 (None), 1 (Minor), 2 (Moderate), 3 (Significant).</p> <p>3. <b>Structural Readings</b>: 0 (None), 1 (Minor), 2 (Moderate), 3 (Significant).</p>

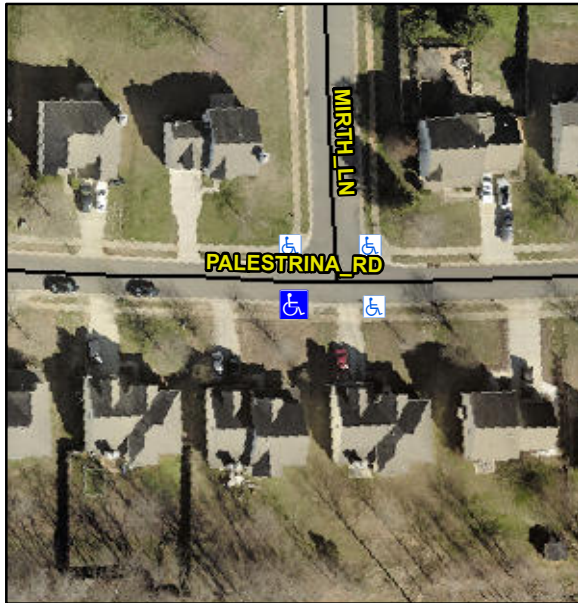

### Possible Solutions:

### Remove & Replace Entire Ramp.

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.2.2**

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data		
<b>Remove &amp; Replace Entire Ramp.</b>			N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	9.0		
			No	Ramp Width (in)	47.5	Yes	Ramp XSlope (%)	1.4		
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
Surveyor Notes: <b>N/A</b>			N/A	Shared Landing?	N/A					
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
				X Walk 1 Direction	To N		X Walk 2 Direction	N/A		
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
				X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	N/A		
				X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	N/A		
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
				Road Slope (%)	N/A	N/A	Clear Space?	N/A		
PROW/ADA: <b>Not Found, R304.5.1, R304.2.2</b>				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
				Obstruction Type			Storm Grate/Utility Type			
					N/A			N/A		
						Yes	Surface Condition? (G/P)	Good		
			Total Cost:			\$	1850.00			

Total Cost: \$ 1850.00

