


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 7422Main Street:BOXMEER_DRCross Street:STATESVILLE_RDLocation:NEADA ID: 3D9BA8290B34Ramp Type:PerpInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:21.25

Codes/Mitigation Info/Possible Solution

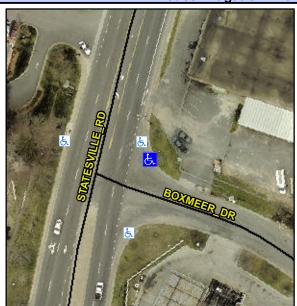

Street 1 Name

Stop Condition-Street 2

StopSign

Street 2 Name

N/A

Stop Condition-Street 1

N/A

Possible Solutions:						
Remove & Replace Entire Ramp.						
Surveyer Nates:						
Surveyor Notes:						
N/A						
PROW/ADA:						
Not Found, R304.5.1, R304.2.2						
, , , , , , , , , , , , , , , , , , , ,						



Total Cost:



1850.00

Field Measurements/Component Compliance							
Compliance Description		Data	Comp	liance	Description	Data	
N/A	Ramp Length (in)	62.0	No	Ramp	Slope (%)	11.0	
No	Ramp Width (in)	36.0	Yes	Ramp	XSlope (%)	1.2	
N/A	Flare Type LT	N/A	N/A	Flare ⁻	Гуре RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare ⁻	Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A	
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter	Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter	X Slope (%)	N/A	
N/A	Painted X Walk1?	No	N/A	Painte	d X Walk2?	N/A	
	X Walk 1 Direction	To SW		X Wall	k 2 Direction	N/A	
N/A	X Walk 1 Width (in)	N/A	N/A	X Wall	k 2 Width (in)	N/A	
	X Walk 1 Slope (%)	1.0		X Wall	k 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	1.2		X Wall	k 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp	inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm	Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm	Grate/Utility Type		
		N/A				N/A	
			Yes	Surfac	e Condition? (G/P)	Good	