


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                        |                                         |                        |
|-----------------------------------------|------------------------|-----------------------------------------|------------------------|
| Intersection ID: 19146                  | Main Street: TYVOLA_RD | Cross Street: WEDGEWOOD_DR              | Location: NE           |
| ADA ID: 43DDFB5763A0                    | Ramp Type: BlendTrans2 | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Severity Score: 22.5                    |                        |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                        | Field Measurements/Component Compliance |                        |

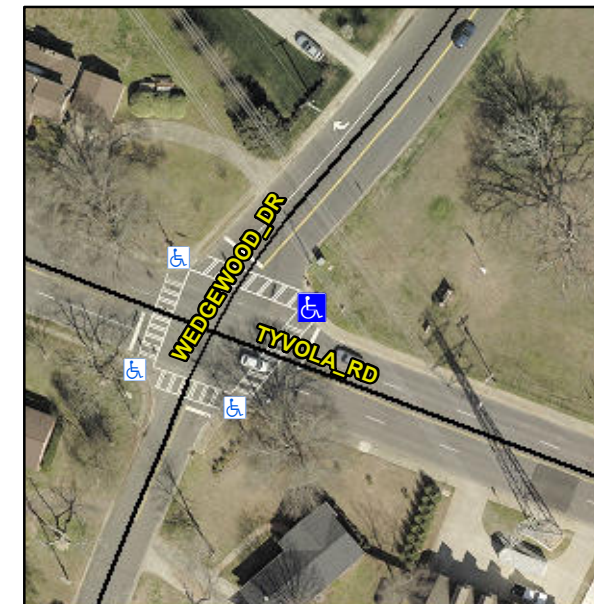

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R305, R302.7, R302.7.2, R304.5.4**

Total Cost: \$ 3950.00

| Compliance | Description           | Data  | Compliance | Description                 | Data  |
|------------|-----------------------|-------|------------|-----------------------------|-------|
| N/A        | Ramp Length (in)      | 57.0  | Yes        | BlendTrans Slope (%)        | 4.2   |
| Yes        | Ramp Width (in)       | 156.0 | Yes        | BlendTrans XSlope (%)       | 1.9   |
| N/A        | Flare Type LT         | None  | N/A        | Flare Type RT               | None  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A   |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A   |
| N/A        | Landing Length (in)   | N/A   | No         | DWS Provided?               | No    |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | No    |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A   |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | No    |
| N/A        | Landing Curb? (Y/N)   | No    | N/A        | DWS Offset (in)             | N/A   |
| N/A        | Shared Landing?       | No    |            |                             |       |
| No         | Gutter Ponding?       | Yes   | No         | Gutter Slope (%)            | 5.3   |
| No         | Gutter Lip Ht (in)    | 0.5   | Yes        | Gutter X Slope (%)          | 1.2   |
| N/A        | Painted X Walk1?      | Yes   | N/A        | Painted X Walk2?            | Yes   |
|            | X Walk 1 Direction    | To NW |            | X Walk 2 Direction          | To SW |
|            | X Walk 1 Width (in)   | 103.0 |            | X Walk 2 Width (in)         | 110.0 |
|            | X Walk 1 Slope (%)    | 5.3   |            | X Walk 2 Slope (%)          | 3.8   |
|            | X Walk 1 X Slope (%)  | 2.4   |            | X Walk 2 X Slope (%)        | 4.1   |
| Yes        | Ramp inside XWalk1?   | Yes   | Yes        | Ramp inside XWalk2?         | Yes   |
|            | Road Slope (%)        | 1.4   |            | Clear Space?                | Yes   |
|            | Road X Slope (%)      | 5.3   | Yes        | Clear Space to XWalk (in)   | 62.0  |
| Yes        | Any Obstructions?     | No    | Yes        | Storm Grate/Utility Hazard? | No    |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |       |
|            |                       | N/A   |            |                             | N/A   |
|            |                       |       | Yes        | Surface Condition? (G/P)    | Good  |
|            |                       |       | No         | Curb Slope (%)              | 20.2  |

