


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 27563 Main Street: BALLANTYNE_FOREST_DR Cross Street: LEDERER_AV Location:

Overall Compliance: No ADA ID: 441EAE436C1E Ramp Type: Perp Initial Pass/Fail: Fail Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

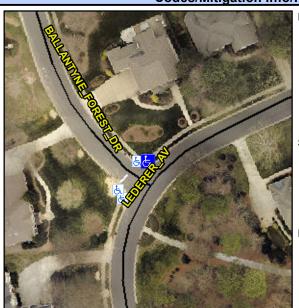

| Street 1 Name | LEDERER AV |
|-------------------------|------------|
| Stop Condition-Street 2 | None |
| Street 2 Name | N/A |
| Stop Condition-Street 1 | N/A |

| Possible Solutions: | | | | | |
|--------------------------------|--|--|--|--|--|
| Remove & Replace Entire Ramp. | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| Surveyor Notes: | | | | | |
| | | | | | |
| N/A | | | | | |
| | | | | | |
| | | | | | |
| PROW/ADA: | | | | | |
| Not Found, R304.5.1, R304.2.2, | | | | | |
| R304.5.3 | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |

| | | | * |
|----------|----------|----|---------------|
| | * | 31 | O ute |
| | | | |
| | | | CA CONTRACTOR |
| # | | | |
| | | | and the Line |
| | | | |
| | | | |
| | | | |

Total Cost:



1850.00

| Field Measurements/Component Compliance | | | | | | |
|---|-----------------------|-------|------|-----------------------------|------|--|
| Comp | liance Description | Data | Comp | liance Description | Data | |
| N/A | Ramp Length (in) | 92.0 | No | Ramp Slope (%) | 9.2 | |
| No | Ramp Width (in) | 39.0 | No | Ramp XSlope (%) | 6.3 | |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A | |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A | |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A | |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A | |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A | |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A | |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A | |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A | |
| N/A | Shared Landing? | N/A | | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A | |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A | |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | N/A | |
| | X Walk 1 Direction | To SE | | X Walk 2 Direction | N/A | |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A | |
| | X Walk 1 Slope (%) | 1.6 | | X Walk 2 Slope (%) | N/A | |
| | X Walk 1 X Slope (%) | 4.0 | | X Walk 2 X Slope (%) | N/A | |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A | |
| | Road Slope (%) | N/A | N/A | Clear Space? | N/A | |
| | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A | |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A | |
| | Obstruction Type | | | Storm Grate/Utility Type | | |
| | | N/A | | | N/A | |
| | | | Yes | Surface Condition? (G/P) | Good | |
| | | | | | | |