


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 4823 Main Street: BEN_CRAIG_DR Cross Street: J_N_PEASE_PL Location: SW **Overall Compliance: No** ADA ID: 4ABFB3003C58 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Severity Score:** 25

Codes/Mitigation Info/Possible Solution

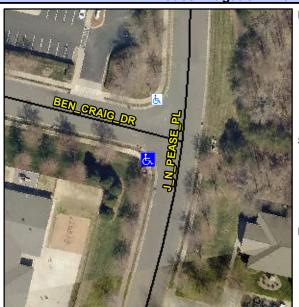

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1

J N PEASE PL None **BEN CRAIG DR** StopSign

Possible Solution	
Possible Solutions:	9
Remove & Replace Curb Ramp With	N
Two New Directional Ramps or	Y
Equivalent.	N
	1
	1
	1
Surveyor Notes:	1
N/A	1
	1
	1
	1
PROW/ADA:	1
Not Found, R304.2.2, R304.5.3	N
	1
	N

Total Cost: 3200.00

	Field Measurements/Component Compliance								
	Compliance Description		Data	Comp	liance Description	Data			
	N/A	Ramp Length (in)	36.0	No	Ramp Slope (%)	9.6			
	Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	6.7			
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A			
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A			
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A			
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A			
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A			
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A			
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A			
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A			
	N/A	Shared Landing?	N/A						
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A			
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A			
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No			
		X Walk 1 Direction	To E		X Walk 2 Direction	To N			
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A			
		X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	3.3			
		X Walk 1 X Slope (%)	5.2		X Walk 2 X Slope (%)	3.0			
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A			
		Road Slope (%)	5.6	N/A	Clear Space?	N/A			
		Road X Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A			
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A			
		Obstruction Type			Storm Grate/Utility Type				
			N/A			N/A			
				Yes	Surface Condition? (G/P)	Good			
(3)	V LOST Y ALL	Property and the second							





