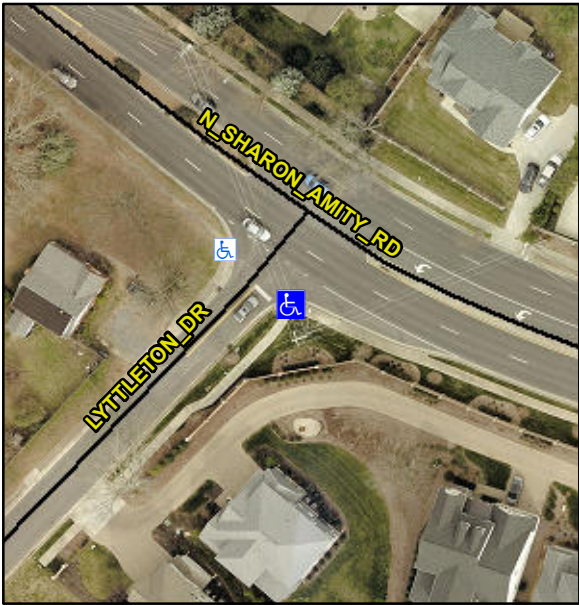


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 17819	Main Street: LYTTLETON_DR	Cross Street: N_SHARON_AMITY_RD	Location: SW
ADA ID: 536D9C25B8BA	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
 <div>Street 1 Name<div>N SHARON AMITY RD</div></div> <div>Stop Condition-Street 1<div>None</div></div> <div>Street 2 Name<div>LYTTLETON DR</div></div> <div>Stop Condition-Street 2<div>StopSign</div></div>	Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			Compliance	Description	Data	Compliance	Description	Data
				N/A	Ramp Length LT (in)	54.0	N/A	Ramp Length RT (in)	52.0
				Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.5
				No	Ramp Slope LT (%)	11.5	Yes	Ramp Slope RT (%)	7.6
				No	Ramp XSlope LT (%)	3.0	No	Ramp XSlope RT (%)	2.1
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Surveyor Notes: CURB LIP 1.0			N/A	Shared Landing?	N/A				
PROW/ADA: R304.3.2, R304.5.3			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
				X Walk 1 Direction	To NE		X Walk 2 Direction	To NW	
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
				X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	0.1	
				X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	0.0	
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
				Road Slope (%)	0.3	N/A	Clear Space?	N/A	
				Road X Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A	
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
				Obstruction Type			Storm Grate/Utility Type		
Total Cost:			\$	3200.00	N/A			N/A	
						Yes	Surface Condition? (G/P)	Good	
						N/A	Curb Slope (%)	5.9	

