


Intersection ID: 53743	Main Street: SMITH_RD	Cross Street: CANTERBURY_CASTLE_DR	Location:	SE
ADA ID: 55F20481F6A3	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 21.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
<p>1. Code: 101</p> <p>2. Mitigation: Increase the number of data points collected during the test.</p> <p>3. Possible Solution: Review the test procedure for any errors or inconsistencies.</p>	<p>1. Field Measurements: The test results show a significant increase in the measured value compared to the expected value.</p> <p>2. Component Compliance: The component does not meet the required specifications.</p>

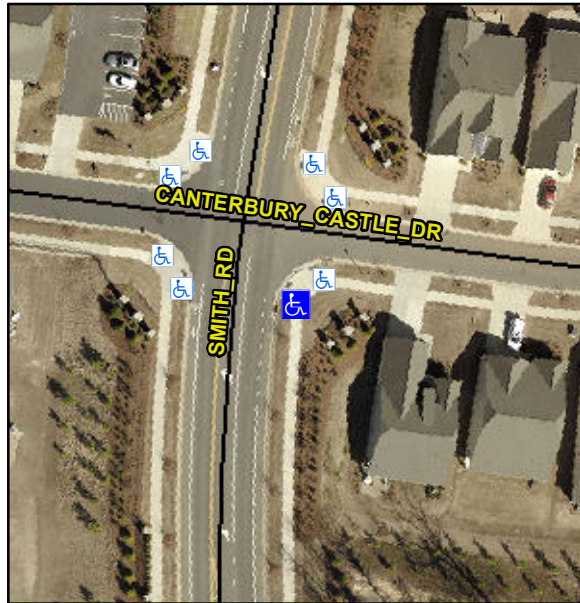

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.5.3

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	94.0	Yes	Ramp Slope (%)	5.7		
	No	Ramp Width (in)	44.0	No	Ramp XSlope (%)	5.3		
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
	N/A	Shared Landing?	N/A					
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
Surveyor Notes: N/A	N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A		
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
		X Walk 1 Direction	To NW		X Walk 2 Direction	N/A		
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
		X Walk 1 Slope (%)	6.0		X Walk 2 Slope (%)	N/A		
		X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	N/A		
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
		Road Slope (%)	N/A	N/A	Clear Space?	N/A		
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
		Obstruction Type			Storm Grate/Utility Type			
			N/A			N/A		
			Yes	Surface Condition? (G/P)	Good			
Total Cost:	\$	1850.00						

Total Cost: \$ 1850.00

