

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

59.5

48.0

3.4

0.0

6.8

0.0

5.9

No

Yes

Yes

24.0

Yes

0.0

1.2

0.7

N/A

Sloped

Intersection ID: 53960 Main Street: DENBUR DR **Cross Street: MAGNOLIA LILY AV** Location: NW **Overall Compliance: No ADA ID: 589140E52FEB** Ramp Type: Combination1 Initial Pass/Fail: Pass **Severity Score:** 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

Yes

Yes

Yes

Yes

N/A

N/A

N/A

Yes

Yes

Yes

Yes

Yes

Yes

Yes

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

Flare Traversable RT?

Ramp XSlope RT (%)

Data

42.0

60.0

3.2

1.5

47.5

48.0

5.0

No

59.5

48.0

0.6

1.0

No

Yes

Yes

0.0

No

Sloped

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Gutter Lip Ht (in)

Painted X Walk1?

Flare Traversable LT?

Flare Type LT


Ramp XSlope LT (%)



None Street 1 Name **DENBUR DR** Stop Condition-Street 1 N/A Street 2 Name Stop Condition-Street 2 N/A Possible Solutions: Compliance Description N/A Remove & Replace Entire Ramp. Yes Yes Yes N/A Yes Surveyor Notes: N/A LT RP < 5%, RT RP < 5% N/A N/A Yes Yes PROW/ADA: Yes Not Found, R302.7 Yes N/A N/A No Yes N/A



Total Cost:

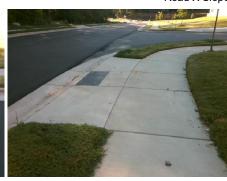

		X Walk 1 Direction	То Е		X Walk 2 Direction	N/A
		X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A
		X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	N/A
1800.00	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	N/A		Clear Space?	Yes
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
	1	Harris .		Yes	Any Obstruction?	No
	12				Obstruction Type	
1						N/A
				Yes	Storm Grate/Utility Hazard?	No
					Storm Grate/Utility Type	110
	-/					N/A
				Yes	Surface Condition? (G/P)	Good
		1 200		l	Curb Slope (%)	19.2