


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 14278	Main Street: ROMARE_BEARDEN_DR	Cross Street: FARMER_ST	Location: E
ADA ID: 59DAC868D2C8	Ramp Type: MedianPerp	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 21.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

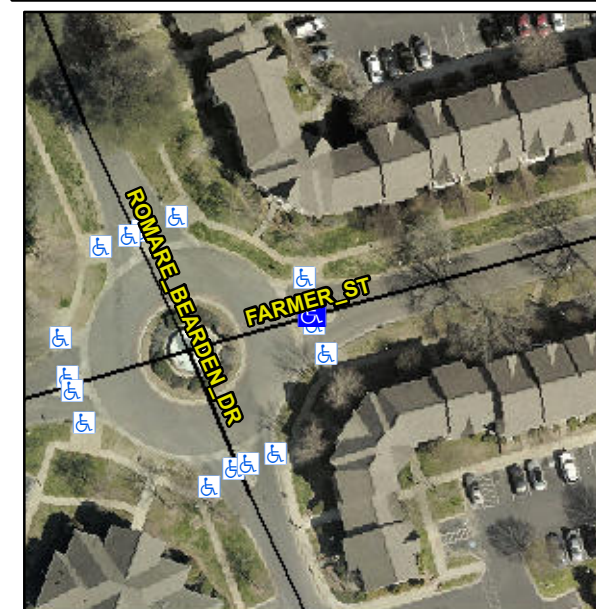

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

Total Cost: \$ 1650.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	39.0	Yes	Ramp Slope (%)	7.5
No	Ramp Width (in)	45.0	No	Ramp XSlope (%)	5.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

Street 1 Name **FARMER ST**  
 Stop Condition-Street 2 **YieldSign**  
 Street 2 Name **N/A**  
 Stop Condition-Street 1 **N/A**

