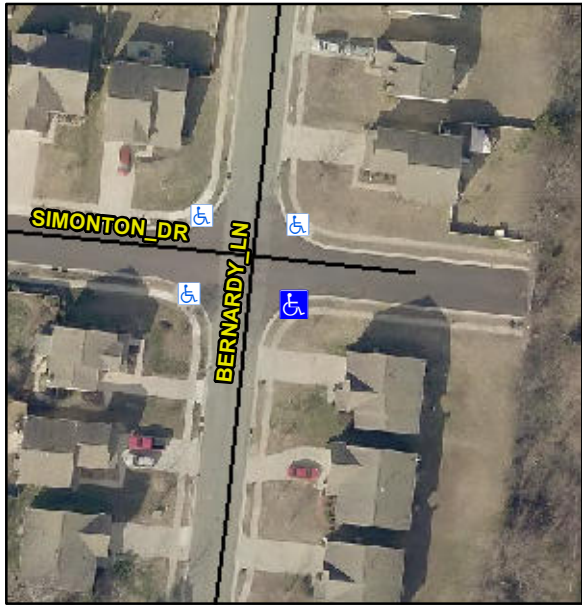


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 43371	Main Street: BERNARDY_LN	Cross Street: SIMONTON_DR	Location: SE
ADA ID: 5BE593FA0EF5	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.					
	Surveyor Notes:		N/A					
	PROW/ADA:		Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para					
	Street 1 Name		BERNARDY LN					
	Stop Condition-Street 1		StopSign					
	Street 2 Name		SIMONTON DR					
	Stop Condition-Street 2		None					
	Total Cost:		\$ 3950.00					
			Compliance	Description	Data	Compliance	Description	Data
			N/A	Ramp Length (in)	48.0	Yes	BlendTrans Slope (%)	1.6
			Yes	Ramp Width (in)	48.0	No	BlendTrans XSlope (%)	4.0
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
			N/A	Flare Slope LT (%)	5.2	N/A	Flare Slope RT (%)	2.6
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
			No	Landing Width (in)	35.0	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	3.6	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	5.8	Yes	DWS Full Width?	Yes
			N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
			Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.1
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To W		X Walk 2 Direction	To N
				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	2.5		X Walk 2 Slope (%)	1.1
				X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	3.4
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	2.9		Clear Space?	Yes
				Road X Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
						No	Curb Slope (%)	8.6

