


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 3889		Main Street: BICKHAM_LN		Cross Street: NEUHOFF_LN		Location: S											
ADA ID: 5CB645F3B032		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 25									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
<div></div> <div>Street 1 Name<div>BICKHAM LN</div></div> <div>Stop Condition-Street 1<div>StopSign</div></div> <div>Street 2 Name<div>N/A</div></div> <div>Stop Condition-Street 2<div>N/A</div></div>				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	59.0		N/A	Grade Break?	N/A					
				Surveyor Notes: N/A		Yes	Ramp Width (in)	48.0		N/A	Grade Break Slope (%)	0.0					
						Yes	Ramp Slope (%)	7.5		N/A	Grade Break XSlope (%)	0.0					
						No	Ramp XSlope (%)	7.5									
						N/A	Flare Type LT	N/A		N/A	Flare Type RT	N/A					
				PROW/ADA: R304.5.3		N/A	Flare Slope LT (%)	N/A		N/A	Flare Slope RT (%)	0.0					
						N/A	Flare Traversable LT?	N/A		N/A	Flare Traversable RT?	N/A					
						N/A	Landing Length (in)	0.0		N/A	DWS Provided?	N/A					
						N/A	Landing Width (in)	0.0		N/A	DWS Contrast?	N/A					
						N/A	Landing Slope (%)	0.0		N/A	DWS Length (in)	N/A					
						N/A	Landing X Slope (%)	0.0		N/A	DWS Full Width?	N/A					
						N/A	Landing Curb? (Y/N)	N/A		N/A	DWS Offset LT (in)	N/A					
						N/A	Shared Landing?	N/A		N/A	DWS Offset RT (in)	N/A					
						N/A	Gutter Ponding?	Yes		N/A	Gutter Slope (%)	N/A					
						N/A	Gutter Lip Ht (in)	0.0		N/A	Gutter X Slope (%)	N/A					
				Total Cost: \$ 1600.00		N/A	Painted X Walk1?	No		Road Slope (%)		0.4					
						X Walk 1 Direction		To NW		Road X Slope (%)		4.1					
						X Walk 1 Width (in)		N/A		Clear Space?		N/A					
						X Walk 1 Slope (%)		0.4		N/A	Clear Space to XWalk (in)	N/A					
						X Walk 1 X Slope (%)		4.1		N/A	Storm Grate/Utility Hazard?	N/A					
						N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type							
						N/A	Any Obstructions?	N/A				N/A					
						Obstruction Type				Yes	Surface Condition? (G/P)	Good					
										N/A	Curb Slope (%)	12.1					

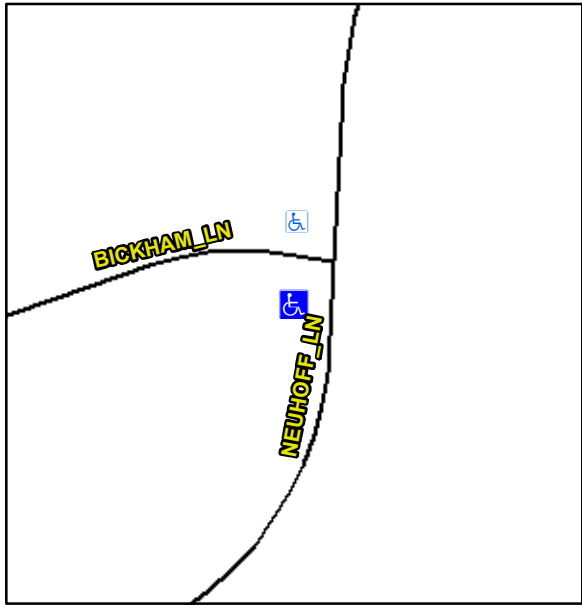