


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10025963 Main Street: ELM_LN Cross Street: N/A Location: NW Severity Score: **Overall Compliance: No** ADA ID: 5DA31F0620E6 Ramp Type: Para Initial Pass/Fail: Fail 12.5

Codes/Mitigation Info/Possible Solution

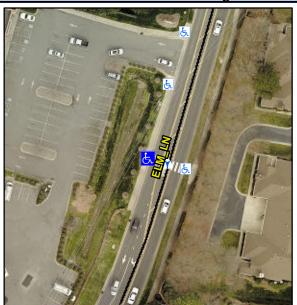

Street 1 Name	ELM LN
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

ossible Solution	
ossible Solutions:	Co
Remove & Replace Entire Ramp.	N/A
·	Ye
	Ye
	Ye
	N/A
	N/A
surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
ROW/ADA:	N/A
R304.3.2	N/A
	N/A
	N/A

Total Cost:	\$ 1600.00

Field Measurements/Component Compliance								
Comp	oliance Description	Data	Comp	liance Description	Data			
N/A	Ramp Length LT (in)	73.0	N/A	Ramp Length RT (in)	70.0			
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.0			
Yes	Ramp Slope LT (%)	5.8	No	Ramp Slope RT (%)	8.5			
Yes	Ramp XSlope LT (%)	0.8	Yes	Ramp XSlope RT (%)	1.9			
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A			
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A			
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A			
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A			
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A			
N/A	Shared Landing?	N/A						
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A			
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A			
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A			
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A			
N/A	X Walk 1 Width (in)	122.0	N/A	X Walk 2 Width (in)	N/A			
	X Walk 1 Slope (%)	7.4		X Walk 2 Slope (%)	N/A			
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A			
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A			
	Road Slope (%)	N/A	N/A	Clear Space?	N/A			
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A			
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A			
	Obstruction Type			Storm Grate/Utility Type				
		N/A			N/A			
			Yes	Surface Condition? (G/P)	Good			
			N/A	Curb Slope (%)	6.9			





