

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12433	Main Street: HARGROVE_AV	Cross Street: MIDLAND_AV	Location: NE
ADA ID: 5DFB0CBF4A18	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

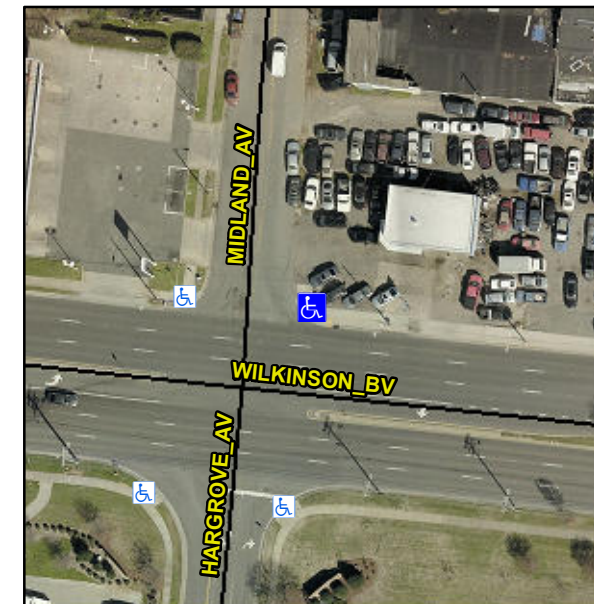

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.2.1, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	48.0	N/A	Ramp Length RT (in)	64.0
Yes	Ramp Width LT (in)	82.0	Yes	Ramp Width RT (in)	83.0
Yes	Ramp Slope LT (%)	1.9	Yes	Ramp Slope RT (%)	6.6
Yes	Ramp XSlope LT (%)	1.9	Yes	Ramp XSlope RT (%)	1.3
Yes	Landing Length (in)	82.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.6	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	1.8
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	0.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.4	N/A	Clear Space?	Yes
	Road X Slope (%)	1.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Replace Curb Slope (%)		9.3

