


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 13654 Main Street: S_TRYON_ST Cross Street: W_PARK_AV Location: N **Overall Compliance: No Severity Score:** ADA ID: 5F37D66768F9 Ramp Type: Perp Initial Pass/Fail: Fail 12.5

Codes/Mitigation Info/Possible Solution

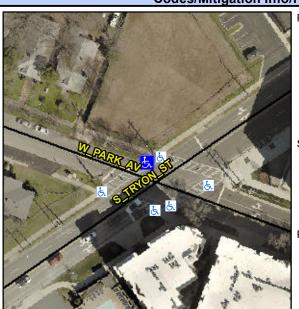

Street 1 Name W PARK AV Signal Stop Condition-Street 2 Street 2 Name N/A Stop Condition-Street 1 N/A

Possible Solutions:	Co
Remove & Replace Entire Ramp.	N/A
	Yes
	N/A
	N/A
	N/A
	N/A
Surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
PROW/ADA:	N/A
Not Found, R304.5.3	N/A
	N/A
	N/A
	N/A

Total Cost:	\$ 1850.00

Field Measurements/Component Compliance								
Compl	iance Description	Data	Comp	liance	Description	Data		
N/A	Ramp Length (in)	124.0	Yes	Ram	o Slope (%)	7.7		
Yes	Ramp Width (in)	55.0	No	Ram	xSlope (%)	5.2		
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A		
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A		
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A		
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A		
N/A	Shared Landing?	N/A						
N/A	Gutter Ponding?	N/A	N/A	Gutte	er Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	er X Slope (%)	N/A		
N/A	Painted X Walk1?	Yes	N/A	Paint	ed X Walk2?	N/A		
	X Walk 1 Direction	To SW		X Wa	lk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	104.0	N/A	X Wa	ılk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	0.2		X Wa	ılk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	2.7		X Wa	ılk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	Yes	N/A	Ram	p inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storn	n Grate/Utility Hazard?	N/A		
	Obstruction Type			Storn	n Grate/Utility Type			
		N/A				N/A		
			Yes	Surfa	ice Condition? (G/P)	Good		





