


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: N/A Main Street: E_MARTIN_LUTHER_KING_JR_CBVss Street: S_COLLEGE_ST Location: Ε

ADA ID: 619A921AC04E Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 50

Codes/Mitigation Info/Possible Solution

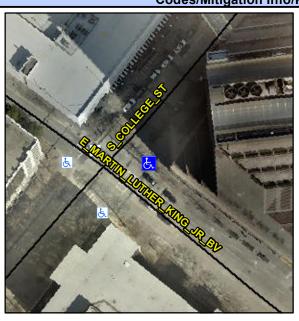

Street 1 Name S COLLEGE ST Stop Condition-Street 2 Signal **E MARTIN LUTHER KING JR BV** Street 2 Name Stop Condition-Street 1 Signal

Possible Solutions: Remove & Replace Curb Ramp With **Two New Directional Ramps or** Equivalent. Surveyor Notes: N/A PROW/ADA: R304.2.2, R304.5.3

Total Cost: 3200.00

Field Measurements/Component Compliance						
Compliance Description			Data	Com	oliance Description	Data
N	/ A	Ramp Length (in)	72.0	No	Ramp Slope (%)	12.9
Ye	es	Ramp Width (in)	72.0	No	Ramp XSlope (%)	7.0
N	/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N	/ A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N	/ A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
N	/ A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N	/ A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N	/ A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N	/ A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N	/ A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N	/ A	Shared Landing?	N/A			
N	/ A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N	/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N	/ A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
		X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N	/ A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	6.4		X Walk 2 Slope (%)	2.4
		X Walk 1 X Slope (%)	6.2		X Walk 2 X Slope (%)	8.7
N	/ A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	6.8	N/A	Clear Space?	N/A
		Road X Slope (%)	5.1	N/A	Clear Space to XWalk (in)	N/A
N	/ A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Obstruction Type		l	Storm Grate/Utility Type	
			N/A			N/A
				Yes	Surface Condition? (G/P)	Good
- M						





